

FORM OG-8

STATE OF WEST VIRGINIA DEPARTMENT OF MINES

JAN 2 9 1986

OIL AND GAS WELLS DIVISION

AFFIDAVIT OF PLUGGING AND FILLING WELL

	Coal Corp		Eastern	Assoc. Coal	Corp.	
Rt. 1, Box ch/4/0			Rt. 1,	Fairview, V	PERATOR IV 26570	*****
Fairview, WV 2	ADDRESS		DOX 144,	COMPLETE ADD		
Refer to attach			December 20,			19 83
COAL OF	PERATOR OR OWNER		Clay	WELL AND LO	CATION	
	ADDRESS					_Distric
J. G. Conawa	У		Monon	galia 	····	_County
1811 Pleas	▼			EACC-F1	-568	•
Fairmont, WV 2	ADDRESS	We	11. No	EACC-FI	-500	
	•		J.	G. Conaway		Farm
STATE INSPECTOR S	UPERVISING PLUGG	ING Bob St	ewart	*** ***********************************	******************************	
•		AFFIDAVI	т.			
STATE OF WEST	VIRGINIA,]				
County of Mor	nongalia	SS:			Ð	
<u> </u>	lvin Eddy	and		Jesse Mille	r	•
being first duly swe	orn according to lav	w depose and sa	-	_		work of
plugging and filling	oil and gas wells and	l were employed	# W.Y	Chisler Brot		
	participated in the wo					
was commenced on and filled in the foll	the 21st day of owing manner:	November	, 19`	and that t	he well was	plugged
SAND OR ZONE RECORD	FILLING	MATERIAL		PLUGS USED	CA	SING
PORMATION				SIZE & KIND	CS & PULLED	CSG
Pulled 150 Joint	40.000					
TOTICG TOO GOING	(3,202'-3'') of	2" casing.			11	tal of
Pumped 7 bags of	Gel and 30 bags	of Chem Comp	Cement,		Set a to 919'-11"	tal of
Pumped 7 bags of Set cement plug	Gel and 30 bags From 2805'-7" to	of Chem Comp 2520'-0".			Set a to 919'-11" casing s	tal of of 4½' tarting
Pumped 7 bags of Set cement plug Pumped 10 bags o	Gel and 30 bags from 2805'-7" to f gel and 10 bags	of Chem Comp 2520'-0". s of Chem Com	p. Cemen	t,	Set a to 919'-11" casing s at the s	tal of of 4½' tarting
Pumped 7 bags of Set cement plug Pumped 10 bags of Set cement plug	Gel and 30 bags from 2805'-7" to f gel and 10 bags from 2301'-0" to	of Chem Comp 2520'-0". s of Chem Com 2220'-0". P	p. Cemen umped 20	t, bags of Che	Set a to 919'-11" casing s at the s	tal of of 4½' tarting
Pumped 7 bags of Set cement plug Pumped 10 bags of Set cement plug Comp Cement, set	Gel and 30 bags from 2805'-7" to f gel and 10 bags from 2301'-0" to cement plug from	of Chem Comp 2520'-0". s of Chem Com 2220'-0". P n 1490'-0" to	p. Cemen umped 20 1424'-0	t, bags of Che	Set a to 919'-11" casing s at the s	tal of of 4½' tarting
Pumped 7 bags of Set cement plug Pumped 10 bags of Set cement plug Comp Cement, set Cut 7" casing at	Gel and 30 bags from 2805'-7" to f gel and 10 bags from 2301'-0" to cement plug from 928'-5". Run 4	of Chem Comp 2520'-0". s of Chem Com 2220'-0". P n 1490'-0" to g" casing to	p. Cemen umped 20 1424'-0	t, bags of Che	Set a to 919'-11" casing s at the s	tal of of 4½' tarting
Pumped 7 bags of Set cement plug Pumped 10 bags of Set cement plug Comp Cement, set Cut 7" casing at pulled 54 joints	Gel and 30 bags from 2805'-7" to f gel and 10 bags from 2301'-0" to cement plug from 928'-5". Run 4 ¹ (928'-5") of 7"	of Chem Comp 2520'-0". s of Chem Com 2220'-0". P n 1490'-0" to g" casing to casing.	p. Gemen umped 20 1424'-0 1420'-0"	t, bags of Che ". then	Set a to 919'-11" casing s at the s	tal of of 4½' tarting
Pumped 7 bags of Set cement plug Pumped 10 bags of Set cement plug Comp Cement, set Cut 7" casing at	Gel and 30 bags from 2805'-7" to f gel and 10 bags from 2301'-0" to cement plug from 928'-5". Run 4 ¹ (928'-5") of 7"	of Chem Comp 2520'-0". s of Chem Com 2220'-0". P n 1490'-0" to g" casing to casing.	p. Gemen umped 20 1424'-0 1420'-0"	t, bags of Che ". then	Set a to 919'-11" casing s at the s	tal of of 4½' tarting
Pumped 7 bags of Set cement plug Pumped 10 bags of Set cement plug Comp Cement, set Cut 7" casing at pulled 54 joints Pumped 5 bags of to 1104'-10".	Gel and 30 bags from 2805'-7" to f gel and 10 bags from 2301'-0" to cement plug from 928'-5". Run 43 (928'-5") of 7" gel and got circ	of Chem Comp 2520'-0". s of Chem Com 2220'-0". P n 1490'-0" to g" casing to casing. culation, pul	p. Gemen umped 20 1424'-0 1420'-0'' led 4½''	t, bags of Che ". then casing	Set a to 919'-11" casing s at the s	tal of of 4½' tarting
Pumped 7 bags of Set cement plug Pumped 10 bags of Set cement plug Comp Cement, set Cut 7" casing at pulled 54 joints Pumped 5 bags of	Gel and 30 bags from 2805'-7" to f gel and 10 bags from 2301'-0" to cement plug from 928'-5". Run 44 (928'-5") of 7" gel and got circles	of Chem Comp 2520'-0". s of Chem Com 2220'-0". P n 1490'-0" to g" casing to casing. culation, pul	p. Gemen umped 20 1424'-0 1420'-0'' led 4½''	t, bags of Che ". then casing	Set a to 919'-11" casing s at the s	tal of of 4½' tarting
Pumped 7 bags of Set cement plug Pumped 10 bags of Set cement plug Comp Cement, set Cut 7" casing at pulled 54 joints Pumped 5 bags of to 1104'-10". Pumped 5 bags of	Gel and 30 bags from 2805'-7" to f gel and 10 bags from 2301'-0" to cement plug from 928'-5". Run 43 (928'-5") of 7" gel and got circles gel, 2 bags of parts.	of Chem Comp 2520'-0". s of Chem Com 2220'-0". P n 1490'-0" to g" casing to casing. culation, pul	p. Gemen umped 20 1424'-0 1420'-0'' led 4½''	t, bags of Che ". then casing	Set a to 919'-11" casing s at the s	tal of of 4½' tarting
Pumped 7 bags of Set cement plug Pumped 10 bags of Set cement plug Comp Cement, set Cut 7" casing at pulled 54 joints Pumped 5 bags of to 1104'-10". Pumped 5 bags of Chem Comp cement	Gel and 30 bags from 2805'-7" to f gel and 10 bags from 2301'-0" to cement plug from 928'-5". Run 43 (928'-5") of 7" gel and got circles gel, 2 bags of parts.	of Chem Comp 2520'-0". s of Chem Com 2220'-0". P n 1490'-0" to g" casing to casing. culation, pul	p. Gemen umped 20 1424'-0 1420'-0'' led 4½''	t, bags of Che ". then casing	Set a to 919'-11" casing s at the s	tal of of 4½' tarting
Pumped 7 bags of Set cement plug Pumped 10 bags of Set cement plug Comp Cement, set Cut 7" casing at pulled 54 joints Pumped 5 bags of to 1104'-10". Pumped 5 bags of Chem Comp cement Refer to attache	Gel and 30 bags from 2805'-7" to f gel and 10 bags from 2301'-0" to cement plug from 928'-5". Run 43 (928'-5") of 7" gel and got circles gel, 2 bags of parts.	of Chem Comp 2520'-0". s of Chem Com 2220'-0". P n 1490'-0" to g" casing to casing. culation, pul	p. Gemen umped 20 1424'-0 1420'-0'' led 4½''	t, bags of Che ". then casing. ags of	Set a to 919'-11" casing s at the s	tal of of 4½ tarting urface.
Pumped 7 bags of Set cement plug Pumped 10 bags of Set cement plug Comp Cement, set Cut 7" casing at pulled 54 joints Pumped 5 bags of to 1104'-10". Pumped 5 bags of Chem Comp cement Refer to attache	Gel and 30 bags from 2805'-7" to gel and 10 bags from 2301'-0" to cement plug from 928'-5". Run 43 (928'-5") of 7" gel and got circ gel, 2 bags of part of the sheet 3 of 3.	of Chem Comp 2520'-0". s of Chem Com 2220'-0". P n 1490'-0" to g" casing to casing. culation, pul	p. Cemen umped 20 1424'-0 1420'-0" led 4½" nd 100 b	t, bags of Che ". then casing. ags of	Set a to 919'-11" casing s at the s	tal of of 4½' tarting urface.
Pumped 7 bags of Set cement plug Pumped 10 bags of Set cement plug Comp Cement, set Cut 7" casing at pulled 54 joints Pumped 5 bags of to 1104'-10". Pumped 5 bags of Chem Comp cement Refer to attache COAL SEAMS AME, Pittsburgh 804	Gel and 30 bags from 2805'-7" to gel and 10 bags from 2301'-0" to cement plug from 928'-5". Run 43 (928'-5") of 7" gel and got circ gel, 2 bags of part of the sheet 3 of 3.	of Chem Comp 2520'-0". s of Chem Com 2220'-0". P n 1490'-0" to g" casing to casing. culation, pul	p. Gemen umped 20 1424'-0 1420'-0" led 4½" nd 100 b	t, bags of Che ". then casing ags of DESCRIPTIO X 2" swedge	Set a to 919'-11" casing s at the s an n N of Monume	tal of of 4½' tarting urface.
Pumped 7 bags of Set cement plug Pumped 10 bags of Set cement plug Comp Cement, set Cut 7" casing at pulled 54 joints Pumped 5 bags of to 1104'-10". Pumped 5 bags of Chem Comp cement Refer to attache COAL SEAMS AME, Pittsburgh 804	Gel and 30 bags from 2805'-7" to gel and 10 bags from 2301'-0" to cement plug from 928'-5". Run 43 (928'-5") of 7" gel and got circ gel, 2 bags of part of the sheet 3 of 3.	of Chem Comp 2520'-0". s of Chem Com 2220'-0". P n 1490'-0" to g" casing to casing. culation, pul	p. Cemen umped 20 1424'-0 1420'-0" led 4½" nd 100 b	bags of Che ". then casing ags of X 2" swedge the surface.	Set a to 919'-11" casing s at the s an N OF MONUME With a 2 A 2" pi	tal of of 4½' tarting urface.
Pumped 7 bags of Set cement plug Pumped 10 bags of Set cement plug Comp Cement, set Cut 7" casing at pulled 54 joints Pumped 5 bags of to 1104'-10". Pumped 5 bags of Chem Comp cement Refer to attache COAL SEAMS AME, Pittsburgh 804	Gel and 30 bags from 2805'-7" to gel and 10 bags from 2301'-0" to cement plug from 928'-5". Run 43 (928'-5") of 7" gel and got circ gel, 2 bags of part of the sheet 3 of 3.	of Chem Comp 2520'-0". s of Chem Com 2220'-0". P n 1490'-0" to g" casing to casing. culation, pul	p. Cemen umped 20 1424'-0 1420'-0" led 4½" nd 100 b 4½" at a m	t, bags of Che ". then casing ags of X 2" swedge the surface. etal plate n	Set a to 919'-11" casing s at the s an N OF MONUME With a 2 A 2" pi	tal of of 4½' tarting urface.
Pumped 7 bags of Set cement plug Pumped 10 bags of Set cement plug Comp Cement, set Cut 7" casing at pulled 54 joints Pumped 5 bags of to 1104'-10". Pumped 5 bags of Chem Comp cement Refer to attache COAL SEAMS AME: AME: AME: AME: COAL SEAMS AME: AME	Gel and 30 bags from 2805'-7" to f gel and 10 bags from 2301'-0" to cement plug from 928'-5". Run 43 (928'-5") of 7" gel and got circ gel, 2 bags of parts of 3.	of Chem Comp 2520'-0". s of Chem Com 2220'-0". P n 1490'-0" to g" casing to casing. culation, pul	p. Cemen umped 20 1424'-0 1420'-0" led 4½" nd 100 b 4½" at a m the	bags of Che ". then casing ags of X 2" swedge the surface. etal plate n 2" pipe.	Set a to 919'-11" casing s at the s an N OF MONUME with a 2 A 2" pi nonument w	tal of of 4½' tarting urface. urface. "stop pe with elded t
Pumped 7 bags of Set cement plug Pumped 10 bags of Set cement plug Comp Cement, set Cut 7" casing at pulled 54 joints Pumped 5 bags of to 1104'-10". Pumped 5 bags of Chem Comp cement Refer to attache COAL SEAMS AME: AME	Gel and 30 bags from 2805'-7" to gel and 10 bags from 2301'-0" to cement plug from 928'-5". Run 43 (928'-5") of 7" gel and got circ gel, 2 bags of part of the sheet 3 of 3.	of Chem Comp 2520'-0". s of Chem Com 2220'-0". P n 1490'-0" to g" casing to casing. culation, pul	p. Cemen umped 20 1424'-0 1420'-0" led 4½" nd 100 b 4½" at a m the	bags of Che ". then casing ags of X 2" swedge the surface. etal plate n 2" pipe.	Set a to 919'-11" casing s at the s an N OF MONUME with a 2 A 2" pi nonument w	tal of of 4½' tarting urface.
Pumped 7 bags of Set cement plug Pumped 10 bags of Set cement plug Comp Cement, set Cut 7" casing at pulled 54 joints Pumped 5 bags of to 1104'-10". Pumped 5 bags of Chem Comp cement Refer to attache COAL SEAMS AME) AME and that the work December	Gel and 30 bags from 2805'-7" to f gel and 10 bags from 2301'-0" to cement plug from 928'-5". Run 43 (928'-5") of 7" gel and got circ gel, 2 bags of red d sheet 3 of 3. -813 Ft. of plugging and fill , 1983	of Chem Comp 2520'-0". s of Chem Com 2220'-0". P n 1490'-0" to g" casing to casing. culation, pul	p. Cemen umped 20 1424'-0 1420'-0" led 4½" nd 100 b 4½" at a m the	bags of Che ". then casing ags of X 2" swedge the surface. etal plate n 2" pipe.	Set a to 919'-11" casing s at the s an N OF MONUME with a 2 A 2" pi nonument w	tal of of 4½ tarting urface. urface. "stop pe with elded t
Pumped 7 bags of Set cement plug Pumped 10 bags of Set cement plug Comp Cement, set Cut 7" casing at pulled 54 joints Pumped 5 bags of to 1104'-10". Pumped 5 bags of Chem Comp cement Refer to attache COAL SEAMS AME) AME and that the work December	Gel and 30 bags from 2805'-7" to f gel and 10 bags from 2301'-0" to cement plug from 928'-5". Run 43 (928'-5") of 7" gel and got circ gel, 2 bags of re- d sheet 3 of 3. -813 Ft.	of Chem Comp 2520'-0". s of Chem Com 2220'-0". P n 1490'-0" to g" casing to casing. culation, pul	p. Cemen umped 20 1424'-0 1420'-0" led 4½" nd 100 b 4½" at a m the	bags of Che ". then casing ags of X 2" swedge the surface. etal plate n 2" pipe.	Set a to 919'-11" casing s at the s an N OF MONUME with a 2 A 2" pi nonument w	tal of of 4½' tarting urface.
Pumped 7 bags of Set cement plug Pumped 10 bags of Set cement plug Comp Cement, set Cut 7" casing at pulled 54 joints Pumped 5 bags of to 1104'-10". Pumped 5 bags of Chem Comp cement Refer to attache COAL SEAMS AME; AME; AME; AME; AME AME AME AME AME AME AME AME AME AM	Gel and 30 bags from 2805'-7" to f gel and 10 bags from 2301'-0" to cement plug from 928'-5". Run 43 (928'-5") of 7" gel and got circ gel, 2 bags of gel, 2 bags of gel, 3 bags of gel, 4 sheet 3 of 3. -813 Ft. of plugging and fill, 1983 conents saith not.	of Chem Comp 2520'-0". s of Chem Com 2220'-0". P 1490'-0" to casing. culation, pul paper mulch a	p. Cemenumped 20 1424'-0 1420'-0" led 4½" nd 100 b 4½" at a m the	bags of Che ". then casing ags of X 2" swedge the surface. etal plate n 2" pipe. eted on the	Set a to 919'-11" casing s at the s an N OF MONUME with a 2 A 2" pi nonument w	tal of of 4½' tarting urface. Unface. INT Stop pe with elded t
Pumped 7 bags of Set cement plug Pumped 10 bags of Set cement plug Comp Cement, set Cut 7" casing at pulled 54 joints Pumped 5 bags of to 1104'-10". Pumped 5 bags of Chem Comp cement Refer to attache COAL SEAMS ME) ME) and that the work December And further dep	Gel and 30 bags from 2805'-7" to f gel and 10 bags from 2301'-0" to cement plug from 928'-5". Run 43 (928'-5") of 7" gel and got circ gel, 2 bags of red d sheet 3 of 3. -813 Ft. of plugging and fill , 1983	of Chem Comp 2520'-0". s of Chem Com 2220'-0". P 1490'-0" to casing. culation, pul paper mulch a	p. Cemenumped 20 1424'-0 1420'-0" led 4½" nd 100 b 4½" at a m the	bags of Che ". then casing ags of X 2" swedge the surface. etal plate n 2" pipe. eted on the	Set a to 919'-11" casing s at the s an N OF MONUME with a 2 A 2" pi nonument w	tal of of 4½ tarting urface.

061-0742-P

Sheet 3 of 3

- (7) Pulled 4½" casing to 932'-8". Pumped 45 bags of Portland Cement but in the process pumped 4 joints of existing 4½" casing out of the well. Pulled remaining 4½" casing out of the well.
- (8) Run 4½" casing on a power swivel (to clean hole) back down to 919'-11". Pumped 29 bags of gel with power swivel.
- (9) Pumped 350 bags of Portland Cement and 144 bags of Chem Comp Cement, got circulation.
- (10) Set latch down plug at 897'-3".