

west virginia department of environmental protection

Office of Oil and Gas 601 57th Street SE Charleston, WV 25304 (304) 926-0450 (304) 926-0452 fax Earl Ray Tomblin, Governor Randy C. Huffman, Cabinet Secretary www.dep.wv.gov

April 28, 2015

WELL WORK PLUGGING PERMIT

Plugging

This permit, API Well Number: 47-7500017, issued to COLUMBIA GAS TRANSMISSION, LLC, is evidence of permission granted to perform the specified well work at the location described on the attached pages and located on the attached plat, subject to the provisions of Chapter 22 of the West Virginia Code of 1931, as amended, and all rules and regulations promulgated thereunder, and to all conditions and provisions outlined in the pages attached hereto. Notification shall be given by the operator to the Oil and Gas Inspector at least 24 hours prior to the construction of roads, locations, and/or pits for any permitted work. In addition, the well operator shall notify the same inspector 24 hours before any actual well work is commenced and prior to running and cementing casing. Spills or emergency discharges must be promptly reported by the operator to 1-800-642-3074 and to the Oil and Gas inspector.

Upon completion of the plugging well work, the above named operator will reclaim the site according to the provisions of WV Code 22-6-30. The above named operator will also file, as required in WV Code 22-6-23, an affidavit on form WR-38 by two experienced persons in the operator's employment and the Oil and Gas inspector that the work authorized under this permit was performed and a description given. Failure to abide by all statutory and regulatory provisions governing all duties and operations here under may result in suspensions or revocation of this permit and in addition may result in civil and/or criminal penalities being imposed upon the operator.

This permit will expire in two (2) years from date of issue. If there are any questions, please free to contact me at (304) 926-0499 ext. 1654.

James Martin Chief

Operator's Well No: 7474

Farm Name: U.S.A.

API Well Number: 47-7500017

Permit Type: Plugging Date Issued: 04/28/2015

Promoting a healthy environment.

PERMIT CONDITIONS

West Virginia Code §22-6-11 allows the Office of Oil and Gas to place specific conditions upon this permit. Permit conditions have the same effect as law. Failure to adhere to the specified permit conditions may result in enforcement action.

CONDITIONS

- 1. All pits must be lined with a minimum of 20 mil thickness synthetic liner.
- 2. In the event of an accident or explosion causing loss of life or serious personal injury in or about the well or while working on the well, the well operator or its contractor shall give notice, stating the particulars of the accident or explosion, to the oil and gas inspector and the Chief within twenty-four (24) hours.
- 3. Well work activities shall not constitute a hazard to the safety of persons.

The Office of Oil and Gas is considering granting a general variance to the requirements under 35CSR4-5.5b of erecting a monument upon the plugging of certain wells. If granted, the following conditions will be met:

- the well will be surveyed and a plat constructed as required under 22-6 of the WV Code and 35CSR4,
- a readily visible, permanent offset marker, in as close proximity as reasonably possible, will be erected and will provide distance and bearing information to the plugged well,
- 3) the plugging affidavit (form WR-38), will document the absence of a monument at the well location and document the existence and location of the offset marker.
- 4) a steel plate no smaller that one square foot shall be affixed to the well casing no deeper than three feet below the ground surface and be inscribed with the api number of the well.

To qualify under the general variance, an operator may make a variance request to the Chief of the Office of Oil and Gas for a specific well(s) in conjunction with a showing of good cause by the surface owner.

- PLACE OFFSET MARKER AT BASE OF A SLOPE, IF POSSIBLE, TO BE MORE PROTECTIVE.
- O PAINT MARKER GREEN. TO FIT IN WITH ENVIRONMENT


WW-4B Rev. 2/01

| 1) Date 2/5 | | , | 20 15 |
|-------------|---------------|---|---------|
| 2) Operat | | - | |
| Well N | . Glady 7474 | | |
| 3) API We | ll No. 47-075 | | - 00017 |

STATE OF WEST VIRGINIA DEPARTMENT OF ENVIRONMENTAL PROTECTION OFFICE OF OIL AND GAS

| | APPLICATION FOR A PERM | MIT TO PLUG AND ABANDON |
|-------|--|---|
| 4) | Well Type: Oil / Gas X / Liquid | d injection / Waste disposal / |
| | | derground storage X) Deep X / Shallow |
| | | |
| 5) | Location: Elevation 1012.3 m (3321.2 ft) | Watershed Mountain Lick Creek of West Fork of East Fork Greenbrier |
| | District Greenbank | County Pocahontas Quadrangle Durbin, WV |
| | | |
| 6) | Well Operator Columbia Gas Transmission, LLC | 7) Designated Agent Paul Amick |
| | Address 1700 MacCorkle Ave SE | Address 1700 MacCorkle Ave SE |
| | Charleston, WV 25325-1273 | Charleston, WV 25325-1273 |
| 10230 | | |
| 8) | Oil and Gas Inspector to be notified | |
| | Name Bryan Harris Address PO Box 157 | Name Contractor Services Inc (CSI) Address 929 Charleston Rd |
| | Volga, WV 26238 | Spencer, WV 25276 |
| | Volga, VV V 20200 | Spericer, VVV 23270 |
| | borehole, install cement plugs across subject intervals based on same critop/surface plug. Grout conductor annulus. Cut off all remaining casing 2 | vintervals known to contain oil, gas, or water. If casing is removed exposing teria. Install cement plugs across all casing top stubs and casing shoes. Install 24" below GL (requested by the US Forestry Service since wells are located in |
| | · SET 200' OF CLASS A CEMENT PLUG | ded on top. Note that 6% bentonite gel will be spotted between all cement plugs. |
| | | |
| | . THE ALL CENEW? PLUGS, ADD CEMEN | T IF NCCOED, |
| | . MUST SET AN OFFSET MARKER | - 9 mm |
| | The state of the s | RECEIVED |
| | | Office of Oil and Gas |
| | ification must be given to the district of k can commence. | ll and gas inspector 24 hours before permitted MAR 1 9 2015 |
| wor. | k order approved by inspector Bush | O'ken' WV Department of Environmedial Protection |

GLADY 7474 2/4/15 (Proposed post P&A)

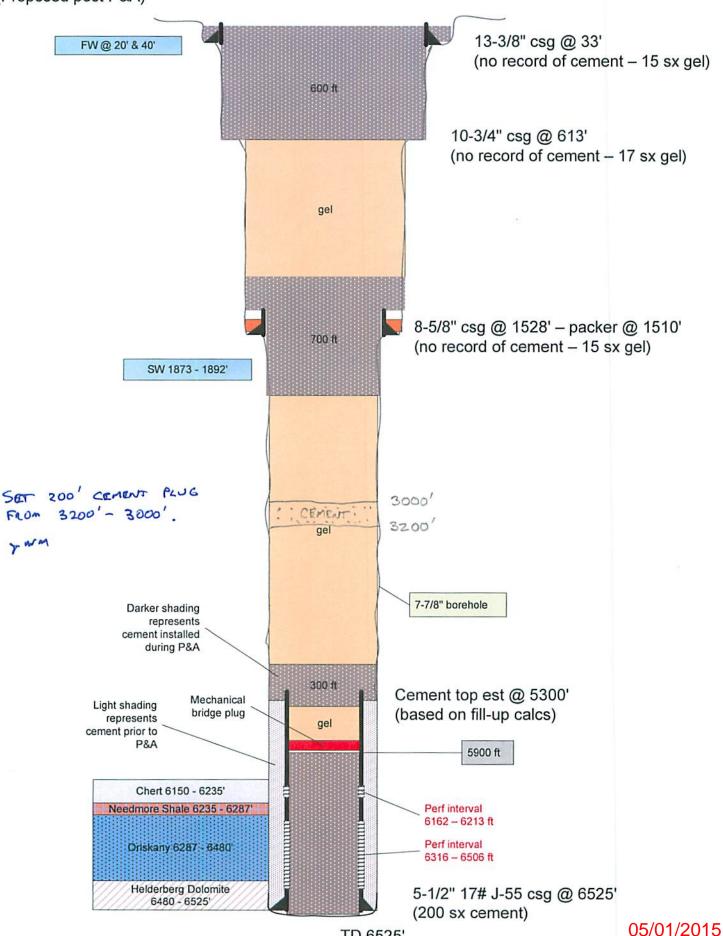

TD 6525'

05/01/2015

Total depth-



GLADY 7474

STATE OF WEST VIRGINIA DEPARTMENT OF MINES OIL AND GAS DIVISION

| Quadrangle Du | whim CF | | | | | | |
|--|------------------------------|-----------------------------|--|--|--|----------------|-------------------|
| _ | Com or | | | | | | |
| Permit No. P | oca-17 | | WELL | RECORD | | Oil or (| Gas Well gas |
| | lumbian C | arbon Comp | any | | | | (KIND) |
| Company Bo | v 873 Cha | rleston 23. | W. Va. | Casing and | Used in | Left in | Packers |
| Addre United | States of A | merica | W. Va. | Tubing | Drilling | Well | |
| Farm Mary F | utnam Fri | isbie | Acres 567. 78 | | | | |
| Location (waters | ;) | | | Size | | | |
| Well No.1 - G | W-1308 | | Elev. 3343, 821 | G ₁₆ | | | Kind of Packer |
| District Green | <u>oank</u> | _County Pocal | nontas tor, Bureau id Mgmt. | ₁₃ 3/8''48# | 331811 | 331811 | М. В. Н. |
| The surface of t | ract is owned in | Direct n fee by of Lar | id Mgmt. | 103/41132# | 61311011 | 613'10" | Size of 8-5/8" |
| | | Address Washi | ngton, D. C. | 81/1 24# | 152811" | 1528'1" | |
| Mineral rights a | re owned by | Director, Bu Land Manage | ngton, D. C. reau of ment, etal | 65% | | | Depth set1515 SLM |
| (for fur | ther add. | contact C. C | , C.) | 53/1617# | 6574'1" | 6574'1" | Depth sec |
| Drilling commen | | | | 3 3/10_ <u>- 1 4</u> | | | Y |
| • | | | | .3/8''4# | 6559'11" | 6559'11" | Perf. top |
| Drilling complet | | | 0 | 6 | w / 2" cag | | Perf. bottom |
| | | | | Liners Used | , | F | Perf. top |
| | | | | | ļ | | Perf. bottom |
| Open Flow | /10ths Water | in | Inch | | <u>L </u> | <u> </u> | |
| | _/10ths Merc. | in | Inch | CASING CEM | FNTFD | SIZE | No. FtDate |
| Volume | | | Cu. Ft. | CABING CLM | | | |
| Rock Pressure_ | | lbs | hrs. | | Bee Teve | Te side | |
| Oil | | | _bbls., 1st 24 hrs. | COAL WAS E | NCOUNTERE | AT <u>none</u> | .FEETINCHES |
| WELL ACIDIZI | en not ac | idized | | FEE' | TINC | HES | FEETINCHES |
| | • | · | | FEE' | TINC | HES | FEETINCHES |
| WELL EDACTI | ipen see | reverse sid | .e | | | | |
| Fresh Water_20 |)1 401 | | hours on B. | | | | |
| Formation | 6.1 | | | Salt Water_± | 873-921 | | t |
| | Color | Hard or Soft | Тор | Salt Water_1 | | | t |
| Top soil | Color | | Ī _ i | | Oil, Gas | Fee | |
| | | | Тор | Bottom | Oil, Gas | Fee | t |
| Slate and Sh | | | Тор | Bottom 10 | Oil, Gas or Water | Depth | Remarks hole full |
| Slate and Sh Sand | ells | | Тор 0 10 | Bottom 10 360 | Oil, Gas or Water | Depth | Remarks hole full |
| Slate and Sh Sand Slate and Sh | ells ells | | Top 0 10 360 495 | Bottom 10 360 495 | Oil, Gas or Water F. water F. water | Depth 201 | Remarks hole full |
| Sand Slate and Sh Brown Shale | ells | | Top 0 10 360 495 2635 | Bottom 10 360 495 2635 2748 | Oil, Gas or Water F. water F. water | Depth 201 | Remarks hole full |
| Slate and Sh Sand Slate and Sh Brown Shale Slate and Sh | ells ells ells | | Top 0 10 360 495 2635 2748 | Bottom 10 360 495 2635 | Oil, Gas or Water F. water F. water | Depth 201 | Remarks hole full |
| Slate and Sh Sand Slate and Sh Brown Shale Slate and Sh Shale and Sh | ells ells ells | | Top 0 10 360 495 2635 2748 3940 | Bottom 10 360 495 2635 2748 3940 | Oil, Gas or Water F. water F. water | Depth 201 | Remarks hole full |
| Slate and Sh Sand Slate and Sh Brown Shale Slate and Sh Shale and Sh Lime and Sh | ells ells ells | | Top 0 10 360 495 2635 2748 3940 4400 | Bottom 10 360 495 2635 2748 3940 4400 4780 | Oil, Gas or Water F. water F. water | Depth 201 | Remarks hole full |
| Slate and Sh Sand Slate and Sh Brown Shale Slate and Sh Shale and Sh Lime and Sh Shale | ells ells ells ells | | Top 0 10 360 495 2635 2748 3940 4400 4780 | Bottom 10 360 495 2635 2748 3940 4400 4780 4870 | Oil, Gas or Water F. water F. water | Depth 201 | Remarks hole full |
| Slate and Sh Sand Slate and Sh Brown Shale Slate and Sh Shale and Sh Lime and Sh Shale Lime and Sh | ells ells ells ells | | Top 0 10 360 495 2635 2748 3940 4400 4780 4870 | Bottom 10 360 495 2635 2748 3940 4400 4780 4870 4975 | Oil, Gas or Water F. water F. water | Depth 201 | Remarks hole full |
| Slate and Sh Sand Slate and Sh Brown Shale Slate and Sh Shale and Sh Lime and Sh Shale Lime and Sh Shale | ells ells ells ells | | Top 0 10 360 495 2635 2748 3940 4400 4780 4870 4975 | Bottom 10 360 495 2635 2748 3940 4400 4780 4870 4975 5215 | Oil, Gas or Water F. water F. water | Depth 201 | Remarks hole full |
| Slate and Sh Sand Slate and Sh Brown Shale Slate and Sh Shale and Sh Lime and Sh Shale Lime and Sh Shale Lime and Sh | ells ells ells ells | | Top 0 10 360 495 2635 2748 3940 4400 4780 4870 4975 5215 | Bottom 10 360 495 2635 2748 3940 4400 4780 4870 4975 5215 5305 | Oil, Gas or Water F. water F. water | Depth 201 | Remarks hole full |
| Slate and Sh Sand Slate and Sh Brown Shale Slate and Sh Shale and Sh Lime and Sh Shale Lime and Sh Shale Lime and Sh Shale | ells ells ells ells ale | | Top 0 10 360 495 2635 2748 3940 4400 4780 4870 4975 5215 5305 | Bottom 10 360 495 2635 2748 3940 4400 4780 4870 4975 5215 5305 5670 | Oil, Gas or Water F. water F. water | Depth 201 | Remarks hole full |
| Slate and Sh Sand Slate and Sh Brown Shale Slate and Sh Shale and Sh Lime and Sh Shale Lime and Sh Shale Lime Shale Lime Shale | ells ells ells ells ale | | Top 0 10 360 495 2635 2748 3940 4400 4780 4870 4975 5215 5305 5670 | Bottom 10 360 495 2635 2748 3940 4400 4780 4870 4975 5215 5305 5670 5830 | Oil, Gas or Water F. water F. water | Depth 201 | Remarks hole full |
| Slate and Sh Sand Slate and Sh Brown Shale Slate and Sh Shale and Sh Shale Lime and Sh Shale Lime Shale Lime Shale Black Shale Grey Shale | ells ells ells ells ale | | Top 0 10 360 495 2635 2748 3940 4400 4780 4870 4975 5215 5305 5670 5830 | Bottom 10 360 495 2635 2748 3940 4400 4780 4870 4975 5215 5305 5670 5830 6140 | Oil, Gas or Water F. water F. water | Depth 201 | Remarks hole full |
| Slate and Sh Sand Slate and Sh Brown Shale Slate and Sh Shale and Sh Lime and Sh Shale Lime and Sh Shale Lime Shale Black Shale Grey Shale Lime and Sh | ells ells ells ells ale | | Top 0 10 360 495 2635 2748 3940 4400 4780 4870 4975 5215 5305 5670 5830 6140 | Bottom 10 360 495 2635 2748 3940 4400 4780 4870 4975 5215 5305 5670 5830 6140 6150 | Oil, Gas or Water F. water F. water | Depth 201 | Remarks hole full |
| Slate and Sh Sand Slate and Sh Brown Shale Slate and Sh Shale and Sh Lime and Sh Shale Lime and Sh Shale Lime Chert Shale Lime Chert | ells ells ells ells ale | | Top 0 10 360 495 2635 2748 3940 4400 4780 4870 4975 5215 5305 5670 5830 6140 6150 | Bottom 10 360 495 2635 2748 3940 4400 4780 4870 4975 5215 5305 5670 5830 6140 6150 6235 | Oil, Gas or Water F. water F. water | Depth 201 | Remarks hole full |
| Slate and Sh Sand Slate and Sh Brown Shale Slate and Sh Shale and Sh Lime and Sh Shale Lime and Sh Shale Lime and Sh Shale Lime Shale Lime Shale Grey Shale Lime and Sh Chert Shale | ells ells ells ells ale | | Top 0 10 360 495 2635 2748 3940 4400 4780 4870 4975 5215 5305 5670 5830 6140 6150 6235 | Bottom 10 360 495 2635 2748 3940 4400 4780 4870 4975 5215 5305 5670 5830 6140 6150 6235 6287 | Oil, Gas or Water F. water F. water | Depth 201 | Remarks hole full |
| Slate and Sh Sand Slate and Sh Brown Shale Slate and Sh Shale and Sh Lime and Sh Shale Lime and Sh Shale Lime Shale Lime Shale Grey Shale Lime and Sh Chert Shale Oriskany Sa | ells ells ells ells ale | | Top 0 10 360 495 2635 2748 3940 4400 4780 4870 4975 5215 5305 5670 5830 6140 6150 6235 6287 | Bottom 10 360 495 2635 2748 3940 4400 4780 4870 4975 5215 5305 5670 5830 6140 6150 6235 6287 6480 | Oil, Gas or Water F. water F. water | Depth 201 | Remarks hole full |
| Slate and Sh Sand Slate and Sh Brown Shale Slate and Sh Shale and Sh Lime and Sh Shale Lime and Sh Shale Lime Chert Shale Chert Shale | ells ells ells ells ale | | Top 0 10 360 495 2635 2748 3940 4400 4780 4870 4975 5215 5305 5670 5830 6140 6150 6235 | Bottom 10 360 495 2635 2748 3940 4400 4780 4870 4975 5215 5305 5670 5830 6140 6150 6235 6287 | Oil, Gas or Water F. water F. water | Depth 201 | Remarks hole full |

65251

| Casing Record 13-3/8" drive pipe - ran 15 sacks Aquagel. 10-3/4" ran with shoe at 605 DLM-17 sacks Aquagel. 8-5/8" ran with Midget bottom hole packer 1515 SLM-15 sacks Aquagel. Circulation & return of the color of the packer 1515 SLM-15 sacks Aquagel. Circulation & return of the color of the packer 1515 SLM-15 sacks Aquagel. Circulation & return of the color of the packer 1515 SLM-15 sacks Aquagel. Circulation & return of the color of the color of the packer 1515 SLM-15 sacks Aquagel. Circulation & return of the color of the colo | Formation | Color | Hard or Soft | Тор | Bottom | Oil, Gas or Water | Depth Found | Remarks |
|---|--------------------------|--|---|--|---|--|---|-------------------------------|
| 10-3/4" ran with shoe at 605'DLM-17 sacks Aquage!. 8-5/8" ran with Midget bottom hele packer 13:15'SLM-15 sacks Aquage!-Circulation & returns W Department of the 200 sacks. FRACTURING RECORD 7-19-60 Perforated the Chert 6162-6213' with 72 shots. 7-21-60 Fractured the Chert 6162-6213' with 72 shots. 7-21-60 Fractured the Chert end of sand. Used 500 barrels water and 35,000# 20-40 sand with 4 drums TMN and 3 drums T-08 Tergito. Flushed with 160 barrels water and Tergitol. Pressure started at 250#. Finished at 3250#. Used 720 barrels water total. Cleaned out sand. 7-27-60 Perforated the Oriskany. Before perforating Oriskany, Chert and Oriskany gas gauged 21,060 cubic feet. Balled hole dry and cleaned out to bottom before fracturing the Oriskany. Nogas in Oriskany when tubed. 8-2-60 Fractured Chert and Oriskany. Pumped in 1,000 harrels water, 30,000# 20-40 sand and 300 perf balls. Started perfo balls in first water. Started sand 1/2#/gallon-put 150 perf balls in quick to seal check. Increased sand to 1-1/2#/gallon. Maximum pressure 3300#. Tubed with 2-3/8" tubing. Final open flow 10-17-60 90 MCF | Casing Rec | ord | | | | | | |
| 10-3/4" raw with shoe at 605'DLM-17 sacks Aquage!. 8-5/8" ran with Midget bottom hole packer 1315'SLM-15 sacks Aquage!-Circulation & returns \$\text{VDE/Datamony}\$ of \$\te | 13-3/8" dr | ve pipe - | ran 15 sack: | Aquagel. | | , | RECEIV | FD |
| 5-1/2" ran at total depth with guide shoe on bottom and five central Cormenger of the Conservation of the | 10-3/4" rai | with sho | at 605'DL | 1- 17 sacks | Aquagel. | \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ | rince or Oil a | nd Gas |
| FRACTURING RECORD 7-19-60 Perforated the Chert 6162-6213' with 72 shots. 7-21-60 Fractured the Chert, Pumped in 1,000 gallons MCA-50 bbls water with Tergitol. Started sand 1/2#/gallon-increased to 1#. Held during treatment, During treatment pressure gradually built up to 2850# at end of sand. Used 500 barrels water and 35,000# 20-40 sand with 4 drun's TMN and 3 drums T-08 Tergito. Flushed with 160 barrels water and Tergitol. Pressure started at 2850#. Finished at 3250# Used 720 barrels water total. Cleaned out sand. 7-27-60 Perforated the Oriskany. Before perforating Oriskany, Chert gas gauged 14,900 cu, ft. After perforating Oriskany, Chert and Oriskany gas gauged 21,060 cubic feet. Bailed hole dry and cleaned out to bottom before fracturing the Oriskany. No gas in Oriskany when tubed. 8-2-60 Fractured Chert and Oriskany. Pumped in 1,000 barrels water, 30,000# 20-40 sand and 300 pert balls. Started perf balls in first water. Started sand 1/2#/gallon-put 150 perf balls in quick to seal check. Increased sand to 1-1/2#/gallon. Maximum pressure 3300#. Tubed with 2-3/8" tubing. Final open flow 10-17-60 90 MCF | 8-5/8" ran | with Midg | et bottom ho | le packer 1 | 15'SLM-15 | sacks Aqua | MAR 1 9 2 | 115 ion & returns. |
| FRACTURING RECORD 7-19-60 Perforated the Chert 6162-6213' with 72 shots. 7-21-60 Fractured the Chert, Pumped in 1,000 gallons MCA-50 bbls water with Tergitol. Started sand 1/2#/gallon-increased to 1#. Held during treatment, During treatment pressure gradually built up to 2850# at end of sand, Used 500 barrels water and 35,000# 20-40 sand with 4 drunts TMN and 3 drums T-08 Tergitol. Flushed with 160 barrels water and Tergitol. Pressure started at 2850#. Finished at 3250# Used 720 barrels water total. Cleaned out sand. 7-27-60 Perforated the Oriskany. Before perforating Oriskany, Chert gas gauged 14,900 cu. ft. After perforating Oriskany, Chert and Oriskany gas gauged 21,060 cubic feet. Bailed hole dry and cleaned out to bottom before fracturing the Oriskany. No gas in Oriskany when tubed. 8-2-60 Fractured Chert and Oriskany. Pumped in 1,000 barrels water, 30,000# 20-40 sand and 300 perf balls. Started perf balls in first water. Started sand 1/2#/gallon-put 150 perf balls in quick to seal check, Increased sand to 1-1/2#/gallon. Maximum pressure 3300#. Tubed with 2-3/8" tubing. Final open flow 10-17-60 90 MCF | 5-1/2" ran 200 sacks. | at total de | pth with gui | de shoe on b | ottom and f | ve centrally | Granselffebr An Debartwe | ent of ed with Diection |
| 7-21-60 Fractured the Chert. Pumped in 1,000 gallons MCA-50 bbls water with Tergitol. Started sand 1/2#/gallon-increased to 1#. Held during treatment. During treatment pressure gradually built up to 2850# at end of sand. Used 500 barrels water and 35,000# 20-40 sand with 4 drums TMN and 3 drums T-08 Tergitol. Flushed with 160 barrels water and 7ergitol. Pressure started at 2350#. Finished at 3250#. Used 720 barrels water total. Cleaned out sand. 7-27-60 Perforated the Oriskany. Before perforating Oriskany, Chert gas gauged 14,900 cu. ft. After perforating Oriskany, Chert and Oriskany gas gauged 21,060 cubic feet. Bailed hole dry and cleaned out to bottom before fracturing the Oriskany. Np gas in Oriskany when tubed. 8-2-60 Fractured Chert and Oriskany. Pumped in 1,000 barrels water, 30,000# 20-40 sand and 300 per balls. Started perf balls in first water. Started sand 1/2#/gallon-put 150 perf balls in quick to seal check. Increased sand to 1-1/2#/gallon. Maximum pressure 3300#. Tubed with 2-3/8" tubing. Final open flow 10-17-60 90 MCF | | } | | | | | | |
| Started sand 1/2#/gallon-increased to 1#. Held during treatment. During treatment pressure gradually built up to 2850# at end of sand. Used 500 barrels water and 35,000# 20-40 sand with 4 drums TMN and 3 drums T-08 Tergitol. Flushed with 160 barrels water and Tergitol. Pressure started at 2850#. Finished at 3250# Used 720 barrels water total. Cleaned out sand. 7-27-60 Perforated the Oriskany. Before perforating Oriskany, Chert gas gauged 14,900 cu. ft. After perforating Oriskany, Chert and Oriskany gas gauged 21,060 cubic feet. Bailed hole dry and cleaned out to bottom before fracturing the Oriskany. No gas in Oriskany when tubed. 8-2-60 Fractured Chert and Oriskany. Pumped in 1,000 barrels water, 30,000# 20-40 sand and 300 perf balls. Started perf balls in first water. Started sand 1/2#/gallon-put 150 perf balls in quick to seal check. Increased sand to 1-1/2#/gallon. Maximum pressure 3300#. Tubed with 2-3/8" tubing. Final open flow 10-17-60 90 MCF | 7-19-60 Pe | rforated th | e Chert 616 | 2-6213' with | 72 shots. | | | |
| 7-27-60 Perforated the Oriskany. Before perforating Oriskany, Chert gas gauged 14,900 cu. ft. After perforating Oriskany, Chert and Oriskany gas gauged 21,060 cubic feet. Bailed hole dry and cleaned out to bottom before fracturing the Oriskany. No gas in Oriskany when tubed. 8-2-60 Fractured Chert and Oriskany. Pumped in 1,000 barrels water, 30,000# 20-40 sand and 300 perf balls. Started perf balls in first water. Started sand 1/2#/gallon-put 150 perf balls in quick to seal check. Increased sand to 1-1/2#/gallon. Maximum pressure 3300#. Tubed with 2-3/8" tubing. Final open flow 10-17-60 90 MCF | gradually be with 4 drum | d 1/2#/gal wilt up to 2 s TMN an | Ion-increas 850# at end d 3 drums T | ed to 1#. He of sand. Us -08 Tergito | ld during tr ed 500 barr l. Flushed v | eatment. Du els water an vith 160 bar: | ring treatm d 35,000# 20 rels water a | ent pressure |
| Before perferating Oriskany, Chert gas gauged 14,900 cu. ft. After perforating Oriskany, Chert and Oriskany gas gauged 21,060 cubic feet. Bailed hole dry and cleaned out to bottom before fracturing the Oriskany. No gas in Oriskany when tubed. 8-2-60 Fractured Chert and Oriskany. Pumped in 1,000 barrels water, 30,000# 20-40 sand and 300 perf balls. Started perf balls in first water. Started sand 1/2#/gallon-put 150 perf balls in quick to seal check. Increased sand to 1-1/2#/gallon. Maximum pressure 3300#. Tubed with 2-3/8" tubing. Final open flow 10-17-60 90 MCF | Cleaned out | sand. | | | | | , | |
| Chert and Oriskany gas gauged 21, 060 cubic feet. Bailed hole dry and cleaned out to bottom before fracturing the Oriskany. No gas in Oriskany when tubed. 8-2-60 Fractured Chert and Oriskany. Pumped in 1,000 barrels water, 30,000 # 20-40 sand and 300 perf balls. Started perf balls in first water. Started sand 1/2#/gallon-put 150 perf balls in quick to seal check. Increased sand to 1-1/2#/gallon. Maximum pressure 3300#. Tubed with 2-3/8" tubing. Final open flow 10-17-60 90 MCF | 7-27-60 Per | forated th | e Oriskany. | | | · | , | |
| and 300 per balls. Started pert balls in first water. Started sand 1/2#/gallon-put 150 perf balls in quick to seal check. Increased sand to 1-1/2#/gallon. Maximum pressure 3300#. Tubed with 2-3/8" tubing. Final open flow 10-17-60 90 MCF | Chert and O | riskany ga | s gauged 21 | ,060 cubic 1 | eet. Bailed | hole dry and | perforating (d cleaned ou | Driskany, t to bottom |
| Tubed with 2-3/8" tubing. Final open flow 10-17-60 90 MCF | and boo per | pame. St | arted peri ba | alls in first | water. Star | ted sand 1/2 | #/gallon=nu | 150 nerf |
| | | | · · | | 1 | | • | |
| | | | ļ | | | | | |
| | | | | | • | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | ı | ı | |
| | ; | | · | | | k | , | |
| | | | , | | | , | , | |
| | | | | , | | , | 1 | - |
| | | - | | ٠ | 1 | | | |
| | | | | | | | | |
| | | | | | | | | |
| μ5/01/2015 | | | | | | | | 05/01/2015 |


| | Date | October 31 | , 19 60 |
|-----------|-----------|--------------------|---------|
| APPROVED_ | Columbian | n Carbon Company | , Owner |
| Ву | W.S. Mon | ore, Mgr, of Prod. | |

mathematical desiration and communications of

| | Color | Hard or Soft | Top /9 | Bottom | Oil, Gas or Water | Depth Found | Remarko |
|--|-------------------------|---|--|---|---|--------------------------|--------------------|
| Casing Reco | rd | | | | | | |
| l3-3/8" dri | ve pipe = : | an 15 sacks | Aquagel | | | | |
| l0-3/4" ran | with shoe | at 605'DLM | - 17 sacks | Aquagel | | | |
| | | t bottom hol | | _ | Ra elea A eu e | .1 6: | _ |
| | l | oth with guid | | | | | |
| 00 sacks. | | ya. wiai guic | e ande on po | ittom and ir | ve centraliza | ers⇒cemente | d with |
| RACTURI | IC PECOD | _ | | | | | |
| | | | | | | | |
| j | | e Chert 6162 | | | | | |
| | -/-//- | Chert. Pur on-increase | 11 T/1 12 WAL | ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ | | | |
| ith 4 drum | TMN and | 3 drums T | 08 Tergitol | Bed 500 bar | rels water a | nd 35,000# | |
| ressure sta | rted at 28 | 50#. Finish | ed at 3250#. | Used 720 b | arrels wate | els water an r total. | d Tergitol. |
| leaned out | sand. | | | | | | • |
| -27-69 Per | orated the | Oriskany. | | | · | • : | |
| efore perfo | rating Ori | skany, Cher | t gas gauge | 1 14, 900 cu | oic feet. Aft | er perforati | na Oriekanı |
| | | s gauged 21 | 0/0 | - | | | TE CITERVANO. |
| ofore fractu | ring Oris | | | | | er perforation to be | ottom |
| ·2-60 Frac | ured Cher | t and Original | in Oriskan | y when tube | dry and clea | ned out to b | ottom |
| ·2-60 Frac | ured Cher balls. Sta | t and Orisk | in Oriskan | y when tube | dry and clead, | aned out to B | ottom 0-40 sand |
| ·2-60 Frac nd 300 perf ills in quick | ured Cher balls. Sta | t and Oriska rted perf bal heck, Increa | in Oriskan By. Pumper Is in first was and to | y when tube i in 1,000 by ater. Start 1-1/2#/gal | dry and clead. arrels watered sand 1/2 | aned out to B | ottom 0-40 sand |
| ·2-60 Frac nd 300 perf ills in quick | ured Cher balls. Sta | t and Orisk | in Oriskan By. Pumper Is in first was and to | y when tube i in 1,000 by ater. Start 1-1/2#/gal | dry and clead. arrels watered sand 1/2 | aned out to B | ottom 0-40 sand |
| ·2-60 Frac nd 300 perf ills in quick | ured Cher balls. Sta | t and Oriska rted perf bal heck, Increa | in Oriskan By. Pumper Is in first was and to | y when tube i in 1,000 by ater. Start 1-1/2#/gal | dry and clead. arrels watered sand 1/2 | aned out to B | ottom 0-40 sand |
| ·2-60 Frac nd 300 perf ills in quick | ured Cher balls. Sta | t and Oriska rted perf bal heck, Increa | in Oriskan By. Pumper Is in first was and to | y when tube i in 1,000 by ater. Start 1-1/2#/gal | dry and clead. arrels watered sand 1/2 | aned out to B | ottom 0-40 sand |
| ·2-60 Frac nd 300 perf ills in quick | ured Cher balls. Sta | t and Oriska rted perf bal heck, Increa | in Oriskan By. Pumper Is in first was and to | y when tube i in 1,000 by ater. Start 1-1/2#/gal | dry and clead. arrels watered sand 1/2 | aned out to B | ottom 0-40 sand |
| ·2-60 Frac nd 300 perf ills in quick | ured Cher balls. Sta | t and Oriska rted perf bal heck, Increa | in Oriskan By. Pumper Is in first was and to | y when tube i in 1,000 by ater. Start 1-1/2#/gal | dry and clead. arrels watered sand 1/2 | aned out to B | ottom 0-40 sand |
| ·2-60 Frac nd 300 perf ills in quick | ured Cher balls. Sta | t and Oriska rted perf bal heck, Increa | in Oriskan By. Pumper Is in first was and to | y when tube i in 1,000 by ater. Start 1-1/2#/gal | dry and clead. arrels watered sand 1/2 | aned out to B | ottom 0-40 sand |
| ·2-60 Frac nd 300 perf ills in quick | ured Cher balls. Sta | t and Oriska rted perf bal heck, Increa | in Oriskan By. Pumper Is in first was and to | y when tube i in 1,000 by ater. Start 1-1/2#/gal | dry and clead. arrels watered sand 1/2 | aned out to B | ottom 0-40 sand |
| ·2-60 Frac nd 300 perf ills in quick | ured Cher balls. Sta | t and Oriska rted perf bal heck. Increa | in Oriskan By. Pumper Is in first was and to | y when tube i in 1,000 by ater. Start 1-1/2#/gal | dry and clead. arrels watered sand 1/2 | aned out to B | ottom 0-40 sand |
| ·2-60 Frac nd 300 perf ills in quick | ured Cher balls. Sta | t and Oriska rted perf bal heck. Increa | in Oriskan By. Pumper Is in first was and to | y when tube i in 1,000 by ater. Start 1-1/2#/gal | dry and clead. arrels watered sand 1/2 | aned out to B | ottom 0-40 sand |
| ·2-60 Frac nd 300 perf ills in quick | ured Cher balls. Sta | t and Oriska rted perf bal heck. Increa | in Oriskan By. Pumper Is in first was and to | y when tube i in 1,000 by ater. Start 1-1/2#/gal | dry and clead. arrels watered sand 1/2 | aned out to B | ottom 0~40 sand |
| ·2-60 Frac nd 300 perf ills in quick | ured Cher balls. Sta | t and Oriska rted perf bal heck. Increa | in Oriskan By. Pumper Is in first was and to | y when tube i in 1,000 by ater. Start 1-1/2#/gal | dry and clead. arrels watered sand 1/2 | aned out to B | ottom 0-40 sand |
| ·2-60 Frac nd 300 perf ills in quick | ured Cher balls. Sta | t and Oriska rted perf bal heck. Increa | in Oriskan By. Pumper Is in first was and to | y when tube i in 1,000 by ater. Start 1-1/2#/gal | dry and clead. arrels watered sand 1/2 | aned out to B | ottom 0-40 sand |

| | Date October 31 , 19 60 |
|----------|-------------------------|
| APPROVED | |
| Ву | W. S. Moore M. |
| | (Title) |

\$L10005L

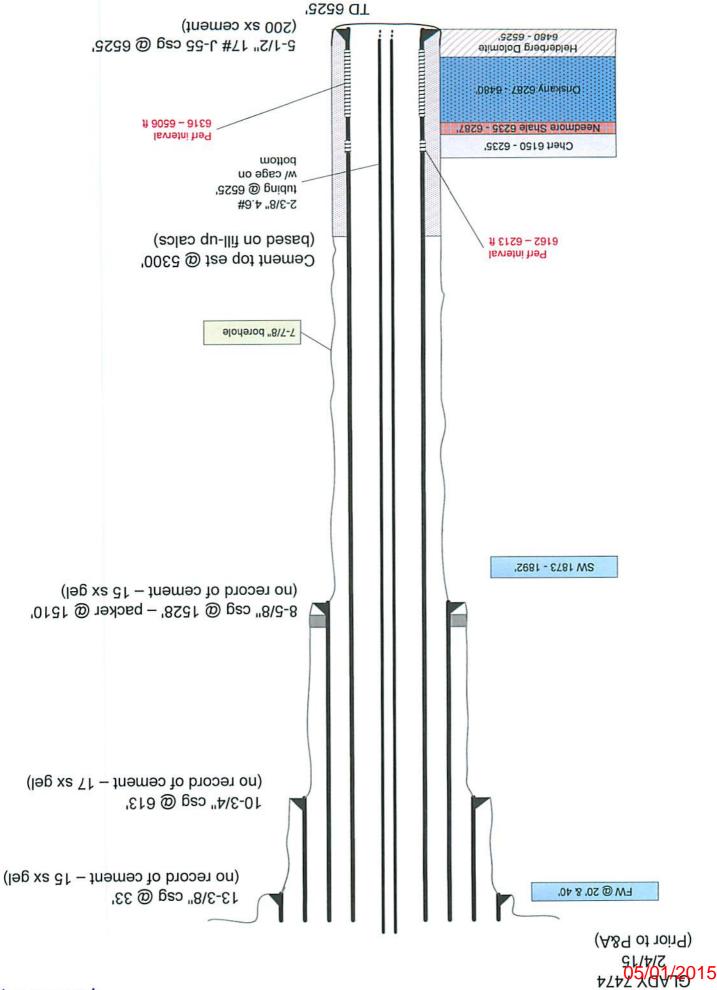

WW-4A Revised 6-07

| 1) Date: 2/5/15 | 1) Date: |
|---------------------------|-------------|
| 2) Operator's Well Number | 2) Operator |
| Glady 7474 | Glady 7474 |
| | 33 |

3) API Well No.: 47 -

075 - 00017

STATE OF WEST VIRGINIA DEPARTMENT OF ENVIRONMENTAL PROTECTION, OFFICE OF OIL AND GAS NOTICE OF APPLICATION TO PLUG AND ABANDON A WELL

| (1) The ap well its (2) The pla The reason yellowever, you Take notice to accompanyin | | ED ABOVE: Y Abandon a Well or ork order; and howing the well loca | Address (b) Coal Owner Name Address Name Address (c) Coal Lessee Name Address (ou should have received a Form WW-4B, which sets tion on Form WW-6. | with Declaration | n e following docu | ments: |
|---|--|---|--|---|---|--|
| (b) Name Address (c) Name Address 6) Inspector Address Telephone TO THE PER (1) The ap well its (2) The pla The reason yellowever, you Take notice to accompanying | Bryan Harris PO Box 157 Volga, WV 26238 304-553-6087 RSONS NAME oplication to Plug and s and the plugging we at (surveyor's map) shou received these documents. | ED ABOVE: Y Abandon a Well or ork order; and howing the well loca | (b) Coal Owner Name Address Name Address (c) Coal Lessee Name Address You should have received a Form WW-4B, which sets tion on Form WW-6. | with Declaration | n e following docu | ments: |
| Address (c) Name Address 6) Inspector Address Telephone TO THE PER (1) The ap well its (2) The pla The reason yellowever, you Take notice to accompanyin | Bryan Harris PO Box 157 Volga, WV 26238 304-553-6087 RSONS NAME oplication to Plug and and the plugging wo at (surveyor's map) shou received these documents. | ED ABOVE: Y I Abandon a Well or ork order; and howing the well loca | Name Address Name Address (c) Coal Lessee Name Address You should have received a Form WW-4B, which sets tion on Form WW-6. | with Declaration | n e following docu | ments: |
| Address (c) Name Address 6) Inspector Address Telephone TO THE PER (1) The ap well its (2) The pla The reason yellowever, you Take notice to accompanyin | PO Box 157 Volga, WV 26238 304-553-6087 RSONS NAME oplication to Plug and and the plugging wo at (surveyor's map) shou received these docum | l Abandon a Well on ork order; and howing the well loca | Name Address Name Address (c) Coal Lessee Name Address You should have received a Form WW-4B, which sets tion on Form WW-6. | with Declaration | n e following docu | ments: |
| (c) Name Address 6) Inspector Address Telephone TO THE PER (1) The ap well its (2) The pla The reason yellowever, you Take notice to accompanying | PO Box 157 Volga, WV 26238 304-553-6087 RSONS NAME oplication to Plug and and the plugging wo at (surveyor's map) shou received these docum | l Abandon a Well on ork order; and howing the well loca | Address Name Address (c) Coal Lessee Name Address You should have received a Form WW-4B, which sets tion on Form WW-6. | with Declaration | n e following docu | ments: |
| Address 6) Inspector Address Telephone TO THE PER (1) The ap well its (2) The pla The reason yellowever, you Take notice to accompanyin | PO Box 157 Volga, WV 26238 304-553-6087 RSONS NAME oplication to Plug and and the plugging wo at (surveyor's map) shou received these docum | l Abandon a Well on ork order; and howing the well loca | Name Address (c) Coal Lessee Name Address You should have received a Form WW-4B, which sets tion on Form WW-6. | d this Form and th | e following docu | |
| Address 6) Inspector Address Telephone TO THE PER (1) The ap well its (2) The pla The reason yellowever, you Take notice to accompanyin | PO Box 157 Volga, WV 26238 304-553-6087 RSONS NAME oplication to Plug and and the plugging wo at (surveyor's map) shou received these docum | l Abandon a Well on ork order; and howing the well loca | Address (c) Coal Lessee Name Address You should have received a Form WW-4B, which sets tion on Form WW-6. | d this Form and th | e following docu | |
| Address 6) Inspector Address Telephone TO THE PER (1) The ap well its (2) The pla The reason yellowever, you Take notice to accompanyin | PO Box 157 Volga, WV 26238 304-553-6087 RSONS NAME oplication to Plug and and the plugging wo at (surveyor's map) shou received these docum | l Abandon a Well on ork order; and howing the well loca | (c) Coal Lessee Name Address You should have received a Form WW-4B, which sets tion on Form WW-6. | d this Form and th | e following docu | |
| 6) Inspector Address Telephone TO THE PER (1) The ap well its (2) The pla The reason yellowever, you Take notice to accompanyin | PO Box 157 Volga, WV 26238 304-553-6087 RSONS NAME oplication to Plug and and the plugging wo at (surveyor's map) shou received these docum | l Abandon a Well on ork order; and howing the well loca | (c) Coal Lessee Name Address You should have received a Form WW-4B, which sets tion on Form WW-6. | d this Form and th | e following docu | |
| Address Telephone TO THE PER (1) The ap well its (2) The pla The reason yellowever, you take notice to accompanyin | PO Box 157 Volga, WV 26238 304-553-6087 RSONS NAME oplication to Plug and and the plugging wo at (surveyor's map) shou received these docum | l Abandon a Well on ork order; and howing the well loca | Name Address You should have received a Form WW-4B, which sets tion on Form WW-6. | d this Form and th | e following docu | |
| Address Telephone TO THE PER (1) The ap well its (2) The pla The reason yellowever, you take notice to accompanyin | PO Box 157 Volga, WV 26238 304-553-6087 RSONS NAME oplication to Plug and and the plugging wo at (surveyor's map) shou received these docum | l Abandon a Well on ork order; and howing the well loca | Name Address You should have received a Form WW-4B, which sets tion on Form WW-6. | d this Form and th | e following docu | |
| Telephone TO THE PER (1) The ap well its (2) The pla The reason yellowever, you take notice to accompanyin | Volga, WV 26238 304-553-6087 RSONS NAME oplication to Plug and and the plugging wo at (surveyor's map) shou received these docum | l Abandon a Well on ork order; and howing the well loca | Address You should have received a Form WW-4B, which sets tion on Form WW-6. | | | |
| (1) The ap well its (2) The pla The reason yellowever, you Take notice to accompanyin | asons NAME pplication to Plug and s and the plugging we at (surveyor's map) shou received these docum | l Abandon a Well on ork order; and howing the well loca | You should have received in Form WW-4B, which sets tion on Form WW-6. | | | |
| (1) The ap well its (2) The pla The reason yellowever, you Take notice to accompanyin | ASONS NAME oplication to Plug and s and the plugging we at (surveyor's map) sl ou received these docum | l Abandon a Well on ork order; and howing the well loca | n Form WW-4B, which sets | | | |
| (1) The ap well its (2) The pla The reason yellowever, you Take notice to accompanyin | oplication to Plug and s and the plugging wo at (surveyor's map) sh ou received these docum | l Abandon a Well on ork order; and howing the well loca | n Form WW-4B, which sets | | | |
| Protection, w the Applicati | g documents for a permi | of the West Virginia Co it to plug and abandon the location described een mailed by register | ode, the undersigned well oper a well with the Chief of the Of l on the attached Application ar ed or certified mail or deliver- ivery to the Chief. | fice of Oil and Gas, We nd depicted on the attac | st Virginia Department hed Form WW-6. Co | nt of Environmental opies of this Notice, |
| | | Well Operato | or Columbia Gas Transmission | on, LLC | 9/ |) |
| | | By: | James E Amos | Jim | - C U | m |
| | | Its: | Senior Well Services Engin | heer | | |
| | | Address | 1700 MacCorkle Ave SE | | | |
| | | nazaman ar | Charleston, WV 25325-12 | 273 | | |
| | | Telephone | 304-483-0073 | | | |
| Subscribed and s | worn before me t are le Expires | his 9th uden 1/22/2015 | day of March | 20 / S Notary Pul | NOTARY NOTARY STATE OF WE MARY MARIE | |



Note that this well is located in the Monongahela National Forest. The surface owner is the US Dept of Interior, and is managed by the BLM and US Forestry Service. Both parties have already approved the proposed well work per the enclosed BLM Sundry Notices and Reports on Wells dated 3/6/15, and USFS Condition of Approval dated 2/20/15. Columbia requests that the 15 day comment period be waived, and the well work permit be issued at the DEP's earliest convenience.

SURFACE OWNER WAIVER

Operator's Well Number

Glady 7474

O SURFACE OWNERS NAMED ON PAGE WW4-A

The well operator named on page WW-4A is applying for a permit from the State to plug and abandon a well. (Note: If the surface tract is owned by more than three persons, then these materials were served on you because your name appeared on the Sheriff's tax ticket on the land or because you actually occupy the surface tract. In either case, you may be the only owner who will actually receive these materials.) See Chapter 22 of the West Virginia Code. Well work permits are valid for 24 months. If you do not own any interest in the surface tract, please forward these materials to the true owner immediately if you know who it is. Also, please notify the well operator and the Office of Oil and Gas.

NOTE: YOU ARE NOT REQUIRED TO FILE ANY COMMENT. WHERE TO FILE COMMENTS AND OBTAIN ADDITIONAL INFORMATION:

Chief, Office of Oil and Gas
Department of Environmental Protection
601 57th St. SE
Charleston, WV 25304
(304) 926-0450

Time Limits and methods for filing comments. The law requires these materials to be served on or before the date the operator files his Application. You have FIVE (5) DAYS after the filing date to file your comments. Comments must be filed in person or received in the mail by the Chief's office by the time stated above. You may call the Chief's office to be sure of the date. Check with your postmaster to ensure adequate delivery time or to arrange special expedited handling. If you have been contacted by the well operator and you have signed a "voluntary statement of no objection" to the planned work described in these materials, then the permit may be issued at any time.

Comments must be in writing. Your comments must include your name, address and telephone number, the well operator's name and well number and the approximate location of the proposed well site including district and county from the application. You may add other documents, such as sketches, maps or photographs to support your comments.

The Chief has the power to deny or condition a well work permit based on comments on the following grounds:

- 1) The proposed well work will constitute a hazard to the safety of persons.
- 2) The soil erosion and sediment control plan is not adequate or effective;
- 3) Damage would occur to publicly owned lands or resources;
- 4) The proposed well work fails to protect fresh water sources or supplies;
- 5) The applicant has committed a substantial violation of a previous permit or a substantial violation of one or more of the rules promulgated under Chapter 22, and has failed to abate or seek review of the violation...".

If you want a copy of the permit as it is issued or a copy of the order denying the permit, you should request a copy from the Chief.

VOLUNTARY STATEMENT OF NO OBJECTION

I hereby state that I have read the instructions to surface owners and that I have received copies of a Notice and Application For A Permit To Plug And Abandon on Forms WW-4A and WW-4B, and a survey plat.

| I further state that I has objection to a permit being issued FOR EXECUTION BY A NATUR ETC. | on those materials. | e planned wor | FOR EXECUTION BY A CORPORATION, |
|---|---------------------|---------------|---------------------------------|
| - | Date | Name | MAR 1 9 2015 |
| Signature | | By Its | Environmental Professionate/201 |

Revisions to Operator-Submitted EC Data for Sundry Notice #293248

BLM Revised (AFMSS) Operator Submitted

VARI NOI Sundry Type: ABD NOI

WVBLMA022927 Lease: WVBLMA023190A

WVES39982 WVES39982 (WVES39982) Agreement:

COLUMBIA GAS TRANSMISSION LLC 1700 MACCORKLE AVE SE CHARLESTON, WV 25325-1273 Ph: 304.373.2412 COLUMBIA GAS TRANSMISSION, LLC 1700 MACCORKLE AVE SE CHARLESTON, WV 25325-1273 Operator:

Ph: 304-357-3445 Fx: 304-373-2438

JAMES E AMOS SENIOR ENGINEER Admin Contact: **JAMES E AMOS**

SENIOR ENGINEER E-Mail: jamos@nisource.com Cell: 304-483-0073 Ph: 304-373-2412

E-Mail: jamos@nisource.com Cell: 304-483-0073 Ph: 304-373-2412 Fx: 304-373-2438 Fx: 304-373-2438

Tech Contact: **JAMES E AMOS** JAMES E AMOS

SENIOR ENGINEER **SENIOR ENGINEER** SENIOR ENGINEER
E-Mail: jamos@nisource.com
Cell: 304-483-0073
Ph: 304-373-2412
Fx: 304-373-2438

SENIOR EINGINEER
E-Mail: jamos@nisource.com
Cell: 304-483-0073
Ph: 304-373-2412
Fx: 304-373-2438

Location:

w State:

WV POCAHONTAS **POCAHONTAS** County:

GLADY STORAGE FIELD Field/Pool: **GLADY**

Well/Facility: **GLADY 7474** 7474 Tract US-20

38.600608 N Lat, 79.784344 W Lon 38.600400 N Lat, 79.784500 W Lon

> RECEIVED Office of Oil and Gas

MAR 1 9 2015

WV Department of Environmental Protection Form 3160-5 (August 2007)

UNITED STATES DEPARTMENT OF THE INTERIOR

FORM APPROVED OMB NO. 1004-0135 Expires: July 31, 2010

| P | IUREAU OF LAND MANA | GEMENT | | | | uly 51, 2010 | |
|--|--|---|--|----------------------------------|---|-------------------------|--|
| | NOTICES AND REPO | | ELLS | | 5. Lease Serial No. WVBLMA022927 | 7 | |
| Do not use the abandoned we | is form for proposals to II. Use form 3160-3 (AP | drill or to re D) for such p | enter an proposals. | | 6. If Indian, Allottee or | Tribe Name | |
| SUBMIT IN TR | IPLICATE - Other instruc | ctions on rev | erse side. | | 7. If Unit or CA/Agreement, Name and/or No. WVES39982 | | |
| I. Type of Well ☐ Gas Well ☑ Or | her: UNKNOWN OTH | | | | 8. Well Name and No. 7474 | | |
| 2. Name of Operator COLUMBIA GAS TRANSMIS | | JAMES E AN source.com | 10S | | 9. API Well No. 47-075-00017-00 |)-S1 | |
| 3a. Address 1700 MACCORKLE AVE SE CHARLESTON, WV 25325- | 1273 | 3b. Phone No Ph: 304-37 Fx: 304-37 | . (include area co 3-2412 3-2438 | de) | 10. Field and Pool, or I GLADY | Exploratory | |
| 4. Location of Well (Footage, Sec., | T., R., M., or Survey Description | 1) | | | 11. County or Parish, a | nd State | |
| Tract US-20 38.600400 N Lat, 79.784500 W Lon | | | | | POCAHONTAS | COUNTY, WV | |
| 12. CHECK APP | ROPRIATE BOX(ES) TO | O INDICATE | NATURE O | F NOTICE, R | EPORT, OR OTHER | DATA | |
| TYPE OF SUBMISSION TYPE OF ACTION | | | | | | | |
| ☑ Notice of Intent | ☐ Acidize | □ Dee | pen | ☐ Product | ion (Start/Resume) | ■ Water Shut-Off | |
| _ | ☐ Alter Casing | ☐ Frac | ture Treat | ☐ Reclam | ation | ■ Well Integrity | |
| ☐ Subsequent Report | ☐ Casing Repair | ☐ Nev | Construction | ☐ Recom | olete | Other Other | |
| ☐ Final Abandonment Notice | ☐ Change Plans | Plug | and Abandon | ☐ Tempor | arily Abandon | Onshore Order Varian ce | |
| | ☐ Convert to Injection | Plug | Back | □ Water I | Disposal | | |
| following completion of the involve testing has been completed. Final A determined that the site is ready for Project to be performed betw Duration: +/- 45 days. P&A Procedure: * refer to "before P&A" and "p." * method of P&A to comply w 1. Kill well. 2. Pull tubing. 3. Obtain cement bond log to 4. Clean to TD and install bot 5. Install mechanical bridge p | bandonment Notices shall be fil final inspection.) een 4/1/15 - 11/15/15. proposed post P&A" wellbe ith WV DEP Office of Oil & determine cemented inte- tom cement plug across s | ore schematic & Gas regulat rval(s). storage perfs/s | requirements, inc s ions/code | ecompletion in a | n, have been completed, a | nd the operator has | |
| 14. I hereby certify that the foregoing i | Electronic Submission # | 1293248 verifie | d by the BLM V | Vell Information | n System | | |
| Com | For COLUMBIA GA mitted to AFMSS for proce | S TRANSMISS | SION LLC, sen DL VAN RYZIN | t to the Milwau on 02/27/2015 | kee (15CVR0025SE) | | |
| Name (Printed/Typed) JAMES E | | | | OR ENGINEE | | | |
| Signature (Electronic | Submission) | | Date 02/26 | 6/2015 | | | |
| | THIS SPACE FO | OR FEDERA | L OR STAT | E OFFICE U | SE | | |
| | | | | | Office of The | - N | |
| Approved By TREY MITCHELL | | | TitlePETRO |) LEUM ENGIN | | Date 03/06/2015 | |
| Conditions of approval, if any, are attached | ed. Approval of this notice does | s not warrant or | | | | o Gas | |
| certify that the applicant holds legal or eq which would entitle the applicant to cond | uitable title to those rights in th | e subject lease | Office Milwa | | MAR 1 9 201 | 5 | |
| Title 18 U.S.C. Section 1001 and Title 43 States any false, fictitious or fraudulent | | a crime for any po s to any matter w | | and willfully to be | ble to any denartment or a | gency of the United | |
| | | | | -11VII | onmental n | rot | |
| ** BLM RE\ | /ISED ** BLM REVISE | D ** BLM RI | EVISED ** B | LM REVISEI | onmentalviser o •• BLM REVISER |)5/09/2015 | |
| | | | | | | | |

Additional data for EC transaction #293248 that would not fit on the form

32. Additional remarks, continued

6. Cut and pull all casing that is free.

7. Perforate and squeeze cement any casing that can't be pulled across driller

Install cement plugs across all driller shows, casing stub tops, and casing shoes.

9. Install top/surface cement plug.

10. Grout conductor annulus.

11. Cut off all remaining casing 24" below GL (per US Forestry Service).

* Note that 8.6 ppg 6% bentonite gel will be spotted between all cement plugs. See request for waiver below.

COLUMBIA IS RESUBMITTING THIS SUNDRY NOTICE PER DIRECTION FROM MR. TREY MITCHELL (BLM ENGINEER) SEEKING RE-APPROVAL WITH THE FOLLOWING WAIVER.

THE WEST VIRGINIA DEPARTMENT OF ENVIRONMENTAL PROTECTION - OFFICE OF OIL & GAS, REQUIRES THAT ALL SPACERS BETWEEN CEMENT PLUGS BE FRESH WATER BASED. ONSHORE OIL & GAS ORDER(S) REQUIRE SPACERS TO HAVE A MINIMUM DENSITY OF 9.0 PPG. BASED ON TYPICAL DRILLING AND WELL SERVICING FLUIDS RHEOLOGY, IN ORDER TO ATTAIN A SPACER FLUID WITH A DENSITY OF 9.0 PPG (OR GREATER) THAT WILL MAINTAIN DENSITY OVER AN EXTENDED PERIOD OF TIME, A SALT COMPONENT IS REQUIRED. PER AN EXPLANATION PROVIDED BY THE WV DEP, SALT (NaCI, KCI, CaCI, etc) IS NOT PERMITTED IN THE SPACER BECAUSE OF THE POSSIBILITY FOR CONTAMINATION OF FRESH WATER STRATA.

DUE TO THE CONFLICTING REGULATORY REQUIREMENTS DESCRIBED ABOVE, COLUMBIA IS REQUESTING A WAIVER FROM THE BLM TO UTILIZE 8.6 PPG 6% BENTONITE GEL SPACERS BASED ON THE FOLLOWING JUSTIFICATION. ACCORDING TO WELL RECORDS AND A +50 YEAR HISTORY OF OPERATING IN THE GLADY STORAGE FIELD, COLUMBIA HAS NO DATA TO SUGGEST THAT PORE PRESSURE GRADIENTS EXCEED 0.447 PSI/FT (8.6 PPG EQUIVALENT). THIS INFO WAS PRESENTED TO MR. MITCHELL VIA TELEPHONE CONVERSATION ON 2/26/15, AND AFTER DISCUSSIONS, WAS DETERMINED SHOULD BE ADEQUATE SUPPORT TO GRANT THE WAIVER AND RE-APPROVE THE SUNDRY NOTICE.

Office of Oil and Gas

MAR 1 9 2015

WV Department of Environmental Protection

7474 47-075-00017 Columbia Gas Transmission, LLC WVES 39982 February 20, 2015 Conditions of Approval

- 1. Contact Jim Wood or Julie King, BLM inspectors, a minimum of 72 hours prior to starting abandoning operations.
- 2. **Variance to Onshore Order 2 III.G.9. A minimum of a 8.6 ppg fluid shall be pumped in between plugs.
- 3. BLM may direct you to test critical/questionable plugs by tagging with the working pipe string.
- 4. Within 30 days after you finish plugging the well, send BLM a final Sundry Notice Form 3160-5 summarizing the actual downhole work performed, the dates the work was started and completed, and the status of reclamation activities.

USFS Final Reclamation Requirements

- 1) Removal of all surface structures, tanks, fence and signs.
- 2) Collection and storage of all drill and produced fluids into tanks.
- 3) Proper disposal of all fluids off National Forest System Lands. Land application is not permitted.
- 4) All pipe/wellhead casing removed down to ground level or below ground as applicable.
- 5) Re-contour the well pad/site to original contour line as practicable or as directed by responsible Forest official.
- 6) The contractor shall provide portable toilets for use during plugging/abandonment and reclamation activities.
- 7) Gathering line(s) to be left in place and welded closed.
- 8) All access roads will be maintained as necessary during the reclamation. After reclamation activities at the well sites have been completed, any Forest Service System road into the well site, for which the operator has been responsible for maintenance activities, shall be reshaped to remove potholes and ruts and to establish proper crowning. All drainage structures including culverts, ditches and dips shall be cleaned, festivated or repaired as necessary for proper drainage. Stone or other suitable materials Challiband Gas provided as necessary to complete the reshaping and repair activities, as determined by the U.S. Forest Service.
- 9) Prior to commencement of activities, the operator shall provide site specific erosion control plans, for the area of disturbance associated with each applying to the U.S. Forest Service for review and acceptance. The erosion control plan shall show all silt-fence, tection

straw bales and other erosion control devices to be used to prevent erosion and to prevent sediment from escaping the work area, and shall show their respective locations. All trapped sediment shall be properly disposed of and all erosion control devices shall be removed from National Forest System Lands upon completion of the reclamation process.

- 10) Earth disturbing/re-contouring activities are to be completed by the end of the normal operating season which is November 15.
- 11) Contact the FS at least 48 hours prior to commencing reclamation measures.
- 12) No trees over 5" DBH shall be cut between March 31st and November 15th without prior Forest Service Approval.
- 13) Addition of organics to the soil and break up of ground compaction may be required to obtain satisfactory re-vegetation. All organics, to be used in the reclamation process, must be approved prior to being brought onto Forest property.
- 14) All non-system Forest Service roads associated with the well site shall be de-compacted and reshaped to match existing ground contours as part of the reclamation process.
- 15) he well site monument will be surveyed, placed at least 2-3 feet below the final ground surface, and located using GPS.
- 16) Use the following enclosed seed mix, lime, fertilizer and straw mulch rates and amounts listed below.

SEEDMIX

Winter Wheat (June 15-Nov. 15) or Spring Wheat (Feb15 – June 15) – 40 lbs./acre Alfalfa (pre inoculated) – 10 lbs./acre Durana Clover (pre inoculated) – 2 lbs./acre Mammoth Red Cover (pre inoculated) – 5 lbs./acre Chicory – 3 lbs./acre

Total seeding will be 60 lbs./acre.

MULCH-

Weed free straw

FERTILIZER-

Use 10-20-10, at 500 lbs./acre

LIME

Lime pellets at 3 tons/acre

RECEIVED
Office of Oil and Gas

MAR 1 9 2015

WV Department of Environmental Protection



Re: Glady Well 7468

William Timmermeyer to Arbogast, Chad H -FS Jim Amos, Jason Chambers

02/20/2015 10:18 AM

Normal Priority.

This message has been replied to and forwarded.

Thank you for the clarification.

Sent from my iPhone

On Feb 20, 2015, at 10:17 AM, Arbogast, Chad H -FS < charbogast/a fs.fed.us > wrote:

The washing of the equipment is geared more toward earth moving equipment such as dozers, excavators, rubber-tired hoes etc. The vehicles should be washed prior to the initial entrance, and rewashed if they are used elsewhere and get coated in heavy soil such as mud in the fender wells, around the bumper, in the undercarriage,

Also, the equipment should be washed when changing areas within the Forest, such as moving from one well pad to another which is not in an adjacent location. The vehicles that are mainly road vehicles are not as great a concern so long as there is no build-up of soil underneath or on the vehicle.

Chad

112 png

Chad Arbogast

Forest Minerals Technician/Greenbrier District Range Manager

Forest Service

Monongahela National Forest

p: 304-456-3335 x121 f: 304-456-3441

charbogast@fs.fed.us

P.O. box 67 Route 250/92

Bartow, WV 24920

www.fs.fed.us

<M3.png><M4.png><M5.png>

Caring for the land and serving people

RECEIVED Office of Oil and Gas

From: wtimmermeyer@nisource.com [mailto:wtimmermeyer@nisource.com]
MAR 1 9 2015

To: Arbogast, Chad H -FS

Cc: jamos@nisource.com; jchambers@nisource.com

Subject: RE: Glady Well 7468

WV Department of Environmental Protection

Chad.

GOVERNMENT CONTACTS

Bureau of Land Management (BLM) Northeastern States Field Office 626 East Wisconsin Ave., Suite 200 Milwaukee, Wisconsin 53202-4617

| Name | Agency/Title | Office Phone | Mobile Phone |
|-------------|----------------------------|---------------------------|----------------|
| Jim Wood | BLM/Engineering Technician | (740) 373-5029 | (414) 573-4548 |
| Julie King | BLM/Engineering Technician | | (985)-856-6296 |
| Will Wilson | FS/Minerals Administrator | (304) 636-1800 Ext 275 | - |

TAM 022015

RECEIVED
Office of Oil and Gas

MAR 1 9 2015

WV Department of Environmental Protection

| | ** | • | T . | | |
|----|-----|----|-----|----|---|
| 11 | / 1 | A | 1 / | ш | _ |
| W | 1 | ٧V | | ٠. | |

| * Coal | not | operated | 1 |
|--------|-----|----------|---|
|--------|-----|----------|---|

| API No. | 075-00017 | |
|-----------|---------------------|--|
| Farm Name | US Dept of Interior | |
| Well No. | Glady 7474 | |

INSTRUCTIONS TO COAL OPERATORS OWNERS AND LESSEE

The well operator named on the obverse side of WW-4 (B) is about to abandon the well described in the enclosed materials and will commence the work of plugging and abandoning said well on the date the inspector is notified. Which date shall not be less then five days after the day on which this notice and application so mailed is received, or in due course should be received by the Department of Environmental Protection Office of Oil & Gas.

This notice and application is given to you in order that your respective representatives may be present at the plugging and filling of said well. You are further notified that whether you are represented or not the operator will proceed to plug and fill said well in the manner required by Section 24, Article 6, Chapter 22 of the Code and given in detail on obverse side of this application.

NOTE: If you wish this well to be plugged according to 22-6-24(d) then as per Regulation 35CSR4-13.9 you must complete and return to this office on form OB-16 "Request by Coal Operator, Owner, or Lessee for plugging" prior to the issuance of this plugging permit.

| | WAIVER |
|---------------------------------------|---|
| has examined this proposed plugging w | / owner/ lessee/ of the coal under this well location fork order. The undersigned has no objection to the work proposed to be all operator has complied with all applicable requirements of the West tions. |
| Date: | |
| 7 | By: |
| | Its |

Office of Oil and Gas

MAR I 9 2015

WV Department of
Environmental Protection
05/01/2015



WW-9 Rev. 5/08

| | Page | | of | |
|-----------------|-------------|-----|-------|--|
| API Number 4 | 7 - 075 | - | 00017 | |
| Operator's Well | No. Glady 7 | 474 | | |


STATE OF WEST VIRGINIA DEPARTMENT OF ENVIRONMENTAL PROTECTION OFFICE OF OIL AND GAS

CONSTRUCTION AND RECLAMATION PLAN AND SITE REGISTRATION APPLICATION FORM GENERAL PERMIT FOR OIL AND GAS PIT WASTE DISCHARGE

| GENERAL TERMIT TOR OIL AND GASTIT WASTE DISCHARGE | |
|--|---|
| Operator Name Columbia Gas Transmission, LLC OP Code 30703 | 2 |
| Watershed Mountain Lick Creek of West Fork of East Fork Greenbrier Quadrangle Durbin, WV | |
| Elevation 1012.3 m (3321.2 ft) County Pocahontas District Green | nback |
| Description of anticipated Pit Waste: fresh water, starch, polymer, bentonite, cement | returns |
| Will a synthetic liner be used in the pit? yes - 30 mil. | |
| Proposed Disposal Method For Treated Pit Wastes: Land Application | |
| | 121-2459 |
| X Underground Injection (UIC Permit Number 34-119-28776, 34-167-23862, 34-1 |) |
| Reuse (at API Number | |
| Off Site Dispposal (Supply form WW-9 for disposal location) X Other (Explain Pinegrove Landfill - Amanda, OH | |
| Proposed Work For Which Pit Will Be Used: | |
| Drilling Swabbing | |
| Workover X Plugging | |
| Other (Explain | |
| provisions of the permit are enforceable by law. Violations of any term or condition of the general plaw or regulation can lead to enforcement action. I certify under penalty of law that I have personally examined and am familiar with the application form and all attachments thereto and that, based on my inquiry of those individuals obtaining the information, I believe that the information is true, accurate, and complete. I am average penalties for submitting false information, including the possibility of fine or imprisonment. | information submitted on this |
| Company Official Signature | MAR 1 9 2015 |
| Company Official (Typed Name) James E Amos | |
| Company Official (Typed Name) Various L 7 11100 | WV Department of |
| Company Official Title Senior Well Services Engineer | Environmental Protection |
| Subscribed and sworn before me this 9th day of March , 20/5 | |
| Mary Marie Clendenen Notory Publi | ic |
| My commission expires $3/22/2015^-$ | OFFICIAL SEAL NOTARY PUBLIC STATE OF WEST VIRGINIA MARY MARIE CLENDENIN COLUMBIA GAS TRANSMOST / 1018/2015 RR 2 BON 35 / 1018/2015 My commission expires March 22, 2015 |

Operator's Well No. Glady 7474

| | EGEND | |
|---|---|-------------------------------|
| Property Boundary | Diversion (4:444111111111111111111111111111111111 | 11111 |
| Road = = = = = = = = = = = | Spring | |
| Existing Fence — X — X — X — | Wet Spot | |
| Planned Fence / / / | Drain Pipe with size in inches (13) | - |
| Stream | Waterway $\longleftrightarrow \longleftrightarrow \longleftrightarrow \longleftrightarrow \longleftrightarrow$ | > |
| Open Ditch | Cross Drain | 1// |
| Rock & SS SS SS | Artificial Filter Strip XXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXX | |
| North N | Pit: cut walls | |
| Buildings | Pit: compacted fill walls | |
| Water wells | Area for Land Application of Pit Waste | |
| Drill site | | |
| | | |
| Proposed Revegetation Treatment: Acres Disturbed < 0.5 a | cre Prevegetation pH 6.0 | |
| | | |
| Lime pellets @ 3 Tons/acre or to correct to pH | 0.0 | |
| Fertilizer (10-20-10 or equivalent) 500 lbs/a | cre (500 lbs minimum) * Note that fertilizer, lime, | 1 |
| Mulch weed free straw @ 2 | mulch, seed mix, and application rates determined | |
| | by US Forestry Service. | |
| Seed | Mixtures | - |
| | THING CO | |
| Area I | Area II | |
| Area I Seed Type lbs/acre | Area II Seed Type lbs/acre | 0 |
| Area I | Area II Seed Type lbs/acre | 2 |
| Area I Seed Type lbs/acre | Area II Seed Type lbs/acre Durana Clover (pre-inoculated) | 2 5 |
| Seed Type Area I lbs/acre Winter Wheat (6/15 - 11/15) 40 | Area II Seed Type lbs/acre Durana Clover (pre-inoculated) Mammoth Red Clover (pre-inoculated) | |
| Seed Type Ibs/acre Winter Wheat (6/15 - 11/15) 40 Spring Wheat (2/15 - 6/15) 40 | Area II Seed Type lbs/acre Durana Clover (pre-inoculated) Mammoth Red Clover (pre-inoculated) | 5 |
| Area I Seed Type Ibs/acre Winter Wheat (6/15 - 11/15) 40 Spring Wheat (2/15 - 6/15) 40 Alfalfa (pre-inoculated) 10 | Area II Seed Type lbs/acre Durana Clover (pre-inoculated) Mammoth Red Clover (pre-inoculated) Chicory | 5 |
| Area I Seed Type Winter Wheat (6/15 - 11/15) Spring Wheat (2/15 - 6/15) Alfalfa (pre-inoculated) * total seeding will be @ 60 lb/acre Attach: Drawing(s) of road, location,pit and proposed area for land applied Photocopied section of involved 7.5' topographic sheet. | Area II Seed Type lbs/acre Durana Clover (pre-inoculated) Mammoth Red Clover (pre-inoculated) Chicory cation. | 5 3 — |
| Area I Seed Type Winter Wheat (6/15 - 11/15) Spring Wheat (2/15 - 6/15) Alfalfa (pre-inoculated) * total seeding will be @ 60 lb/acre Attach: Drawing(s) of road, location,pit and proposed area for land applied Photocopied section of involved 7.5' topographic sheet. Plan Approved by: Seed Type Ibs/acre Winter Wheat (6/15 - 11/15) 40 Attach: The proposed area for land applied to the proposed area | Area II Seed Type Ibs/acre Durana Clover (pre-inoculated) Mammoth Red Clover (pre-inoculated) Chicory cation. | 5 3 |
| Area I Seed Type Winter Wheat (6/15 - 11/15) Spring Wheat (2/15 - 6/15) Alfalfa (pre-inoculated) * total seeding will be @ 60 lb/acre Attach: Drawing(s) of road, location,pit and proposed area for land applied Photocopied section of involved 7.5' topographic sheet. Plan Approved by: Seed Type Ibs/acre Winter Wheat (6/15 - 11/15) 40 Attach: The proposed area for land applied to the proposed area | Area II Seed Type lbs/acre Durana Clover (pre-inoculated) Mammoth Red Clover (pre-inoculated) Chicory cation. RECEIV | 3 ZED and Gas |
| Area I Seed Type Winter Wheat (6/15 - 11/15) Spring Wheat (2/15 - 6/15) Alfalfa (pre-inoculated) * total seeding will be @ 60 lb/acre Attach: Drawing(s) of road, location,pit and proposed area for land applied Photocopied section of involved 7.5' topographic sheet. Plan Approved by: Seed Type Ibs/acre Winter Wheat (6/15 - 11/15) 40 Attach: The proposed area for land applied to the proposed area | Area II Seed Type Ibs/acre Durana Clover (pre-inoculated) Mammoth Red Clover (pre-inoculated) Chicory cation. RECEIV Office of Oil a | 3 ZED and Gas |
| Area I Seed Type Winter Wheat (6/15 - 11/15) Spring Wheat (2/15 - 6/15) Alfalfa (pre-inoculated) * total seeding will be @ 60 lb/acre Attach: Drawing(s) of road, location,pit and proposed area for land applied Photocopied section of involved 7.5' topographic sheet. Plan Approved by: Seed Type Ibs/acre Winter Wheat (6/15 - 11/15) 40 Attach: The proposed area for land applied to the proposed area | Area II Seed Type Ibs/acre Durana Clover (pre-inoculated) Mammoth Red Clover (pre-inoculated) Chicory cation. RECEIV Office of Oil a | 5 3 - /ED and Gas |
| Area I Seed Type Winter Wheat (6/15 - 11/15) 40 Spring Wheat (2/15 - 6/15) 40 Alfalfa (pre-inoculated) * total seeding will be @ 60 lb/acre Attach: Drawing(s) of road, location,pit and proposed area for land applied Photocopied section of involved 7.5' topographic sheet. Plan Approved by: Drawing(s) Plan Approved by: Drawing(s) O Here Comments: | Area II Seed Type Ibs/acre Durana Clover (pre-inoculated) Mammoth Red Clover (pre-inoculated) Chicory cation. RECEIV Office of Oil a | 5 3 - /ED and Gas |

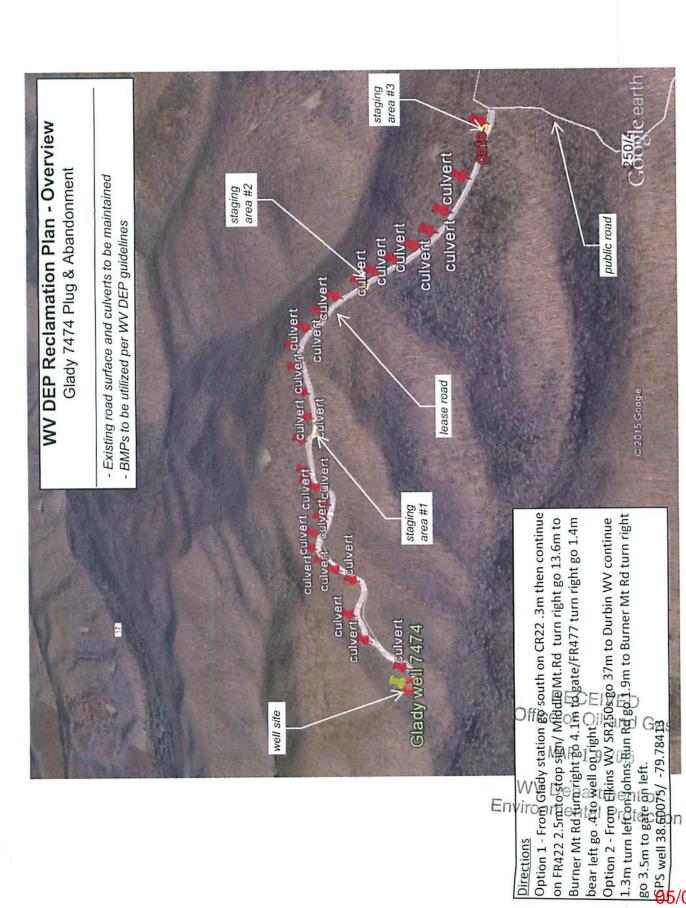


4000


ogle earth

feet km




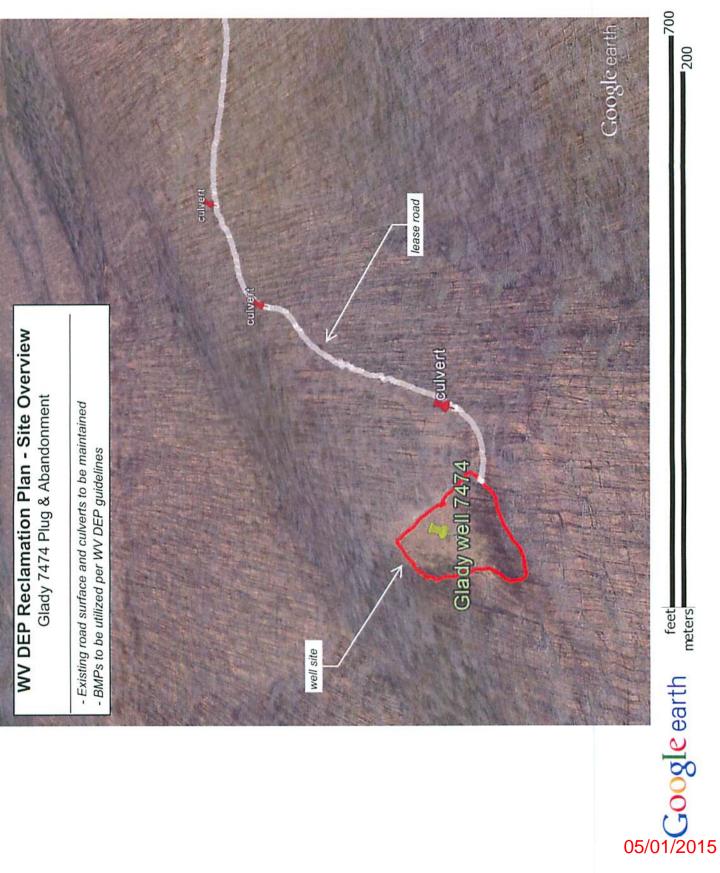



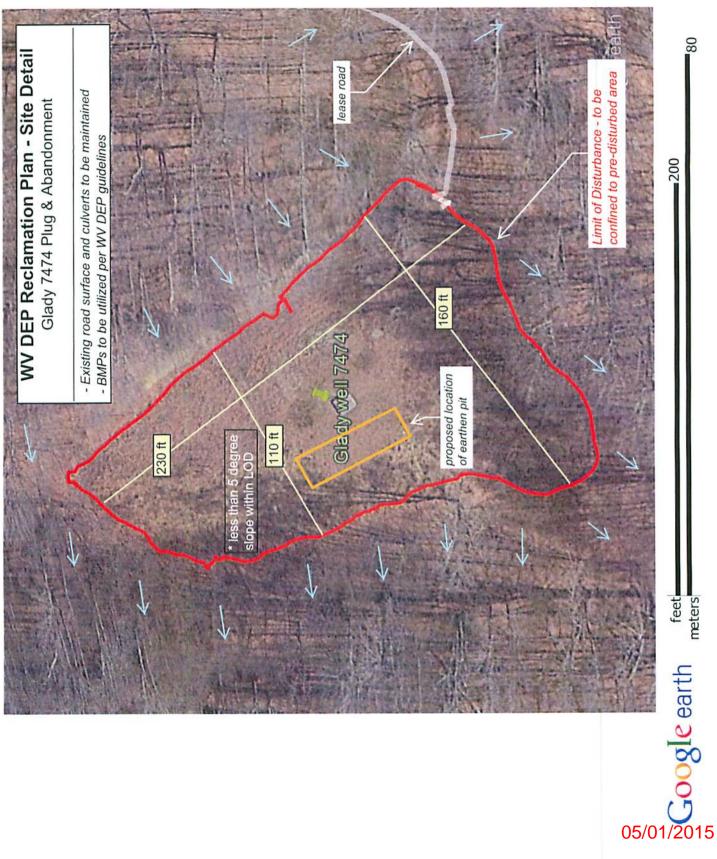



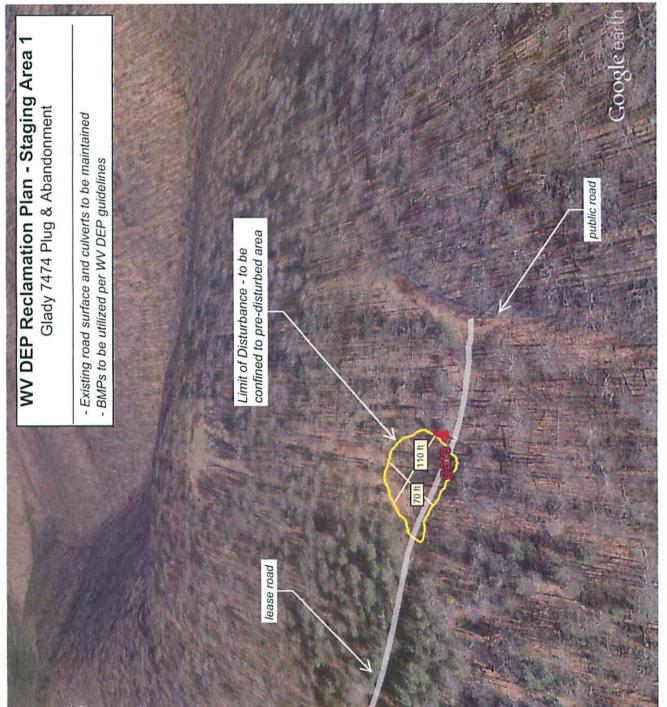


05/01/2015



90



o5/01/2015

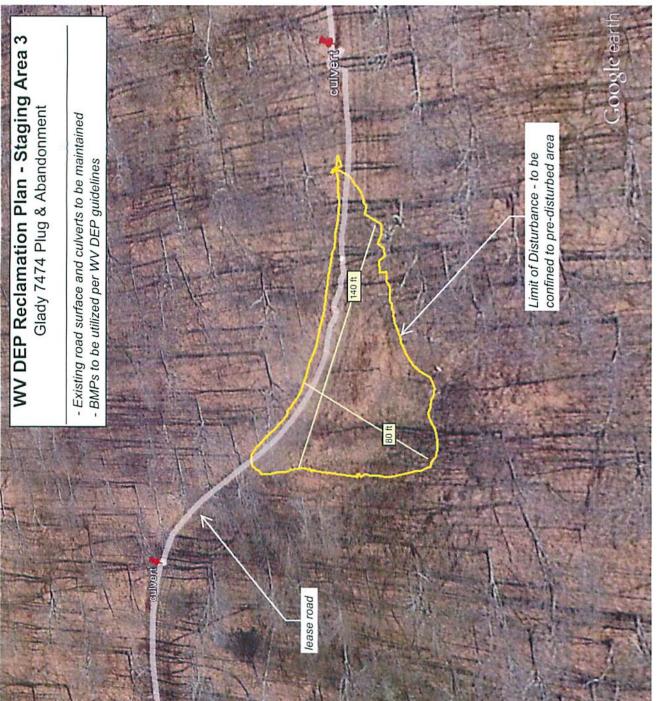

-200

80

05/01/2015

WW-7 8-30-06



West Virginia Department of Environmental Protection Office of Oil and Gas WELL LOCATION FORM: CPS

| WELL LOCATION FORM: GPS |
|--|
| API: 47-075-00017 WELL NO.: 7474 |
| FARM NAME: US Dept of Interior |
| RESPONSIBLE PARTY NAME: Columbia Gas Transmission, LLC |
| COUNTY: Pocahontas DISTRICT: Greenbank |
| QUADRANGLE: Durbin, WV |
| SURFACE OWNER: US Dept of Interior |
| ROYALTY OWNER: US Dept of Interior (storage lease) |
| UTM GPS NORTHING: 4273157.8 m |
| UTM GPS EASTING: 605856.7 m GPS ELEVATION: 1012.3 m (3320') |
| The Responsible Party named above has chosen to submit GPS coordinates in lieu of preparing a new well location plat for a plugging permit or assigned API number on the above well. The Office of Oil and Gas will not accept GPS coordinates that do not meet the following requirements: 1. Datum: NAD 1983, Zone: 17 North, Coordinate Units: meters, Altitude: height above mean sea level (MSL) – meters. 2. Accuracy to Datum – 3.05 meters 3. Data Collection Method: Survey grade GPS: Post Processed Differential |
| Real-Time Differential X |
| |
| Real-Time Differential MAR 1 9 2015 |
| 4. Letter size copy of the topography map showing the well location. Department of I the undersigned, hereby certify this data is correct to the best of my knowledge and entail protection prescribed by the Office of Oil and Gas. |
| Senior Engineer 1/27/15 |
| Signature Title Date |
| 05/01/2015 |