

STATE OF WEST VIRGINIA
DEPARTMENT OF ENVIRONMENTAL PROTECTION
OFFICE OF OIL AND GAS

AFFIDAVIT OF PLUGGING AND FILLING WELL

AFFIDAVIT SHOULD BE IN TRIPLICATE, one copy mailed to the Department, one copy to be retained by the Well Operator and the third copy (and extra copies if required) should be mailed to each coal operator at their respective addresses.

Farm name: Caples Resources, Inc Operator Well No.: 1338

LOCATION: Elevation: 2271' Quadrangle: Welch
District: Browns Creek County: McDowell
Latitude: 4100 Feet South of 37 Deg. 30 Min. 0 Sec.
Longitude: 5000 Feet West of 81 Deg. 32 Min. 30 Sec.

Well Type: OIL _____ GAS X

Company Diversified Producon, LLC Coal Operator Berwind Land Company
PO Box 6070 or Owner 300 Summers Street, Suite 1050
Charleston, WV 25362 Charleston, WV 25301

Agent Jeff Mast Coal Operator _____
Permit Issued Date 9-21-21 or Owner _____

AFFIDAVIT

STATE OF WEST VIRGINIA, KY
County of Floyd ss:

Rodney Osborne and Estill Johnson being first duly sworn according to law depose and say that they are experienced in the work of plugging and filling oil and gas wells and were employed by the above named well operator, and participated in the work of plugging and filling the above well say that said work was commenced on the 18 day of Nov, 2021, and the well was plugged and filled in the following manner:


TYPE	FROM	TO	PIPE REMOVED	LEFT
See Attachment A			1288' of 4 1/2"	21' of 11 3/4"
				1318' of 7"
				2222' of 4 1/2"

Description of monument: 7" casing w/ API # 36" above ground and that the work of plugging and filling said well was completed on the 23 day of Nov, 2021.

And further deponents saith not. [Signature]
Estill Johnson

Sworn and subscribe before me this 29 day of November, 2021

My commission expires: 2-4-2022 Stella M Slove
Notary Public

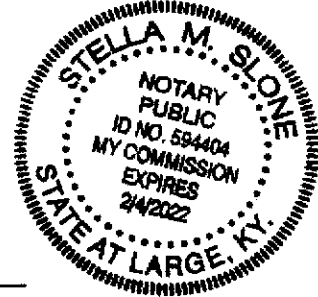

Affidavit reviewed by the Office of Oil and Gas: [Signature] Title: Inspector 12/10/2021

Attachment A
47-047-01235

Bottom Class A Cement	Top	Actual TOC	# sks
3394'	3215'	3190'	20
2686'	2564'	2510'	15
2282'	2179'		10
2034'	1906'	1883'	15
1849'	1749'		8
1656'	1556'		8
1375'	1150'		35
463'	322'	289'	30
106'	Surface		27

WELL PLUGGING INSPECTION & RELEASE FORM

PLUGGING COMMENCED 11/18/21
 PLUGGING COMPLETED 11/23/21
 VERBAL PERMISSION ON _____

OPERATOR: Dress And Production
 FARM: Captles Resources, Inc.
 WELL NO: 1338

1. IS COAL BEING MINED IN THE AREA? YES NO N/A
2. WERE CEMENT AND GEL MIXED AND USED IN ACCORDANCE WITH ACCEPTED INDUSTRY STANDARDS?
 - A. BOTTOM HOLE PLUGGED YES NO N/A
 - B. 100' PLUGS YES NO N/A
 - C. LATEX PLUGS USED FOR H₂S GAS YES NO N/A
 - D. PROPER PLUGS THROUGH COAL SEAMS YES NO N/A
 - E. PROPER PLUGS SET TO PROTECT FRESHWATER YES NO N/A
 - F. PROPER AMOUNT OF GEL USED TO DISPLACE PLUGS YES NO N/A

TYPE	FROM	TO	PIPE REMOVED
Class A Cement	3215'	3190'	1288' - 4 1/2"
Class A Cement	2686'	2510'	
Class A Cement	2282'	2179'	
Class A Cement	2034'	1906'	
Class A Cement	1849'	1749'	
Class A Cement	1656'	1556'	
Class A Cement	1375'	1150'	
Class A Cement	463'	289'	
Class A Cement	106'	Surface	
<u>6" Gel between Plugs.</u>			

3. WERE ALL CHANGES APPROVED BY INSPECTOR? YES NO
4. WAS THE EQUIPMENT USED FOR PULLING CASING PROPERLY SIZED AND RIGGED TO PULL 150% OF THE HEAVIEST STRING OF PIPE EXPECTED TO BE PULLED? YES NO
5. DID THE OPERATOR GIVE THE INSPECTOR PROPER NOTICE? YES NO
6. WERE ACCURATE PLUGGING RECORDS KEPT BY THE OPERATOR? YES NO
7. WAS A PROPER MONUMENT SET WITH API NUMBER ATTACHED? YES NO
8. DID WELL SITE AND ACCESS ROAD MEET THE FOLLOWING RECLAMATION REQUIREMENTS?

A. RECLAIMED	<input checked="" type="radio"/> YES	NO	B. FENCES REPLACED	<input checked="" type="radio"/> YES	NO
C. MULCHED	<input checked="" type="radio"/> YES	NO	D. PROPER DRAINAGE	<input checked="" type="radio"/> YES	NO
E. SEEDED	<input checked="" type="radio"/> YES	NO	F. ALL EQUIPMENT REMOVED	<input checked="" type="radio"/> YES	NO
G. PIT BACKFILLED	<input checked="" type="radio"/> YES	NO			

12/6/21
DATE RELEASED

[Signature]
INSPECTOR'S SIGNATURE

RECORD ALL VISITS TO THIS WELL ON PAGE 2