

STATE OF WEST VIRGINIA
DEPARTMENT OF ENVIRONMENTAL PROTECTION
OFFICE OF OIL AND GAS

AFFIDAVIT OF PLUGGING AND FILLING WELL

AFFIDAVIT SHOULD BE IN TRIPLICATE, one copy mailed to the Department, one copy to be retained by the Well Operator and the third copy (and extra copies if required) should be mailed to each coal operator at their respective addresses.

Farm name: SHREWSBURY, V. & G. Operator Well No.: V. SHREWSBURY 1

LOCATION: Elevation: 2576' Quadrangle: MOLOAKA
District: ROCK County: MERCER
Latitude: 37.488360741931 Feet South of _____ Deg. _____ Min. _____ Sec.
Longitude: -81.1462832762598 Feet West of _____ Deg. _____ Min. _____ Sec.

Well Type: OIL _____ GAS X

Company ALLIANCE PETROLEUM Coal Operator KOLAN V. LILLY
101 MCQUISTON DRIVE or Owner 1588 CAMP CREEK ROAD
JACKSON CENTER, PA 16133 CAMP CREEK, WV 25820
Agent JEFF MAST Coal Operator _____
Permit Issued Date 3/15/21 or Owner _____

AFFIDAVIT

STATE OF WEST VIRGINIA,
County of MERCER ss:

MELVIN MYERS and JAMES PURSLEY being first duly sworn according to law depose and say that they are experienced in the work of plugging and filling oil and gas wells and were employed by the above named well operator, and participated in the work of plugging and filling the above well say that said work was commenced on the 25TH day of JUNE, 2021, and the well was plugged and filled in the following manner:


TYPE	FROM	TO	PIPE REMOVED	LEFT
C1A CEMENT	4876'	3882'	980' X 4.5" CSG	3537' X 4.5" CSG CEMENTED
C1A CEMENT	2577'	2210'		
C1A CEMENT	1890'	1610'		462' X 7" CSG CTS
C1A CEMENT	1200'	1100'		
C1A CEMENT	1020'	920'		20' X 9.625" CSG
C1A CEMENT	512'	412'		
C1A CEMENT	120'	SURFACE	6% GEL BETWEEN ALL PLUGS	

Description of monument: 7" CSG WITH API#, 36" ABOVE GROUND and that the work of plugging and filling said well was completed on the 30TH day of JUNE, 2021.

And further deponents saith not. *[Signatures]*

Sworn and subscribe before me this 9th day of July, 2021

My commission expires: Sept. 18, 2024
Sandra L. Messer
Notary Public

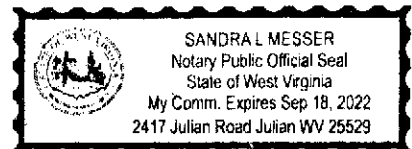

Affidavit reviewed by the Office of Oil and Gas: *[Signature]* Title: Inspector

WELL PLUGGING INSPECTION & RELEASE FORM

PLUGGING COMMENCED 6/25/21
 PLUGGING COMPLETED 6/30/21
 VERBAL PERMISSION ON _____

OPERATOR: Alliance Petroleum
 FARM: Shrewsbury, Vt.
 WELL NO: V. Shrewsbury 1

1. IS COAL BEING MINED IN THE AREA? YES NO N/A
2. WERE CEMENT AND GEL MIXED AND USED IN ACCORDANCE WITH ACCEPTED INDUSTRY STANDARDS?
 - A. BOTTOM HOLE PLUGGED YES NO N/A
 - B. 100' PLUGS YES NO N/A
 - C. LATEX PLUGS USED FOR H₂S GAS YES NO N/A
 - D. PROPER PLUGS THROUGH COAL SEAMS YES NO N/A
 - E. PROPER PLUGS SET TO PROTECT FRESHWATER YES NO N/A
 - F. PROPER AMOUNT OF GEL USED TO DISPLACE PLUGS YES NO N/A

TYPE	FROM	TO	PIPE REMOVED
Cement class A	4676'	3882'	980' - 4.5 casing
Cement class A	2577'	2210'	
Cement class A	1840'	1610'	
Cement class A	1200'	1100'	
Cement class A	1020'	920'	
Cement class A	512'	412'	
Cement class A	120'	Surface	
6% Gel between plugs			

3. WERE ALL CHANGES APPROVED BY INSPECTOR? YES NO
4. WAS THE EQUIPMENT USED FOR PULLING CASING PROPERLY SIZED AND RIGGED TO PULL 150% OF THE HEAVIEST STRING OF PIPE EXPECTED TO BE PULLED? YES NO
5. DID THE OPERATOR GIVE THE INSPECTOR PROPER NOTICE? YES NO
6. WERE ACCURATE PLUGGING RECORDS KEPT BY THE OPERATOR? YES NO
7. WAS A PROPER MONUMENT SET WITH API NUMBER ATTACHED? YES NO
8. DID WELL SITE AND ACCESS ROAD MEET THE FOLLOWING RECLAMATION REQUIREMENTS?

A. RECLAIMED	<input checked="" type="checkbox"/> YES	NO	B. FENCES REPLACED	<input checked="" type="checkbox"/> YES	NO
C. MULCHED	<input checked="" type="checkbox"/> YES	NO	D. PROPER DRAINAGE	<input checked="" type="checkbox"/> YES	NO
E. SEEDED	<input checked="" type="checkbox"/> YES	NO	F. ALL EQUIPMENT REMOVED	<input checked="" type="checkbox"/> YES	NO
G. PIT BACKFILLED	<input checked="" type="checkbox"/> YES	NO			

10/18/21
DATE RELEASED

[Signature]
INSPECTOR'S SIGNATURE

RECORD ALL VISITS TO THIS WELL ON PAGE 2

10/22/2021