

STATE OF WEST VIRGINIA
DEPARTMENT OF ENVIRONMENTAL PROTECTION
OFFICE OF OIL AND GAS

AFFIDAVIT OF PLUGGING AND FILLING WELL

AFFIDAVIT SHOULD BE IN TRIPLICATE, one copy mailed to the Department, one copy to be retained by the Well Operator and the third copy (and extra copies if required) should be mailed to each coal operator at their respective addresses.

Farm name: UNKNOWN Operator Well No.: ROWLAND LAND 26

LOCATION: Elevation: 2036' Quadrangle: ARNETTE
District: MARSH FORK County: RALEIGH
Latitude: 8830' Feet South of 37 Deg. 50 Min. 0 Sec.
Longitude: 730' Feet West of 81 Deg. 27 Min. 30 Sec.

Well Type: OIL _____ GAS X

Company DIVERSIFIED PRODUCTION LLC Coal Operator ROWLAND LAND COMPANY, LLC
414 SUMMER STREET or Owner 405 CAPITAL STREET, SUITE 609
CHARLESTON, WV 25301 CHARLESTON, WV 25301
Coal Operator NO DECLARATION
Agent JEFF MAST or Owner _____
Permit Issued Date 06/17/21

AFFIDAVIT

STATE OF WEST VIRGINIA,
County of JACKSON ss:


MELVIN MYERS and MICHAEL PROCTOR being first duly sworn according to law depose and say that they are experienced in the work of plugging and filling oil and gas wells and were employed by the above named well operator, and participated in the work of plugging and filling the above well say that said work was commenced on the 18TH day of AUGUST, 2021, and the well was plugged and filled in the following manner:

TYPE	FROM	TO	PIPE REMOVED	LEFT
56 SACKS OF C1A CEMENT	2642'	1906'		CIBP at 2642'
19 SACKS OF C1A CEMENT	618'	518'		
19 SACKS OF C1A CEMENT	345'	245'	568' OF 4 1/2" TUBING	3,325' OF 4 1/2" TUBING
19 SACKS OF C1A CEMENT	100'	SURFACE		1,226' OF 7" CASING CTS
8% GEL SPACERS BETWEEN PLUGS				

Description of monument: 7" CSG WITH API # 36" ABOVE GROUND and that the work of plugging and filling said well was completed on the 25TH day of AUGUST, 2021

And further deponents saith not.

[Handwritten signatures]

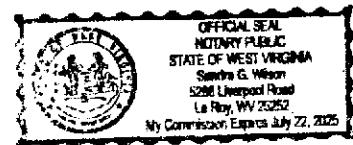

Sworn and subscribe before me this 18th day of November, 2021

My commission expires: 7/22/2025
[Signature: Sandra G. Wilson]
Notary Public

Affidavit reviewed by the Office of Oil and Gas: *[Signature: Amy Kennedy]* Title: Inspector

11/26/2021

WELL PLUGGING INSPECTION & RELEASE FORM

PLUGGING COMMENCED 8/18/21
 PLUGGING COMPLETED 8/25/21
 VERBAL PERMISSION ON _____

OPERATOR: Drassfield Production
 FARM: Unknown
 WELL NO: Roughneck Land 26

1. IS COAL BEING MINED IN THE AREA? YES NO N/A
2. WERE CEMENT AND GEL MIXED AND USED IN ACCORDANCE WITH ACCEPTED INDUSTRY STANDARDS?
 - A. BOTTOM HOLE PLUGGED YES NO N/A
 - B. 100' PLUGS YES NO N/A
 - C. LATEX PLUGS USED FOR H₂S GAS YES NO N/A
 - D. PROPER PLUGS THROUGH COAL SEAMS YES NO N/A
 - E. PROPER PLUGS SET TO PROTECT FRESHWATER YES NO N/A
 - F. PROPER AMOUNT OF GEL USED TO DISPLACE PLUGS YES NO N/A

TYPE	FROM	TO	PIPE REMOVED
<u>Class A Cement</u>	<u>2642'</u>	<u>1906'</u>	<u>568'-4 1/2</u>
<u>Class A Cement</u>	<u>618'</u>	<u>518'</u>	
<u>Class A Cement</u>	<u>345'</u>	<u>245'</u>	
<u>Class A Cement</u>	<u>100'</u>	<u>Surface</u>	
<u>6% Gel between plugs</u>			

3. WERE ALL CHANGES APPROVED BY INSPECTOR? YES NO
4. WAS THE EQUIPMENT USED FOR PULLING CASING PROPERLY SIZED AND RIGGED TO PULL 150% OF THE HEAVIEST STRING OF PIPE EXPECTED TO BE PULLED? YES NO
5. DID THE OPERATOR GIVE THE INSPECTOR PROPER NOTICE? YES NO
6. WERE ACCURATE PLUGGING RECORDS KEPT BY THE OPERATOR? YES NO
7. WAS A PROPER MONUMENT SET WITH API NUMBER ATTACHED? YES NO
8. DID WELL SITE AND ACCESS ROAD MEET THE FOLLOWING RECLAMATION REQUIREMENTS?

A. RECLAIMED <input checked="" type="checkbox"/> YES NO	B. FENCES REPLACED <input checked="" type="checkbox"/> YES NO
C. MULCHED <input checked="" type="checkbox"/> YES NO	D. PROPER DRAINAGE <input checked="" type="checkbox"/> YES NO
E. SEEDED <input checked="" type="checkbox"/> YES NO	F. ALL EQUIPMENT REMOVED <input checked="" type="checkbox"/> YES NO
G. PIT BACKFILLED <input checked="" type="checkbox"/> YES NO	

11/23/21
DATE RELEASED

[Signature]
INSPECTOR'S SIGNATURE

RECORD ALL VISITS TO THIS WELL ON PAGE 2