

STATE OF WEST VIRGINIA
DEPARTMENT OF ENVIRONMENTAL PROTECTION
OFFICE OF OIL AND GAS

AFFIDAVIT OF PLUGGING AND FILLING WELL

AFFIDAVIT SHOULD BE IN TRIPLICATE, one copy mailed to the Department, one copy to be retained by the Well Operator and the third copy (and extra copies if required) should be mailed to each coal operator at their respective addresses.

Farm name: Plum Creek Timberland Operator Well No.: 507791

LOCATION: Elevation: 1950.13 Quadrangle: Oceana
District: Clear Fork County: Wyoming
Latitude: 41 Feet South of 69 Deg. 661 Min. 45 Sec.
Longitude: 43 Feet West of 77 Deg. 13 Min. 89 Sec.

Well Type: OIL _____ GAS X

Company CM Energy Holdings, LP Coal Operator CM Energy Operations, LP
200 George Street, Suite 4 or Owner 200 George Street, Suite 4
Beckley, WV 25801 Beckley, WV 25801
Agent Jim Higgins Coal Operator WPP LLC
Permit Issued Date 5-7-21 or Owner 5260 Irwin Road
Huntington, WV 25705

AFFIDAVIT

STATE OF WEST VIRGINIA,
County of Floyd ss:

Rodney Osborne and Estill Johnson being first duly sworn according to law depose and say that they are experienced in the work of plugging and filling oil and gas wells and were employed by the above named well operator, and participated in the work of plugging and filling the above well say that said work was commenced on the 3 day of June, 2021, and the well was plugged and filled in the following manner:

TYPE	FROM	TO	PIPE REMOVED	LEFT
See Attachment A			1224' of 4 1/2"	139' of 13 3/8" Grouted
				1209' of 9 5/8" CTS
				5070' of 4 1/2"


Description of monument: 7" casing w/ API # 36" above ground and that the work of plugging and filling said well was completed on the 11 day of June, 2021.

And further deponents saith not. [Signature]
Estill Johnson

Sworn and subscribe before me this 14 day of June, 2021

My commission expires: 2/4/2022

Stella M. Stone
Notary Public

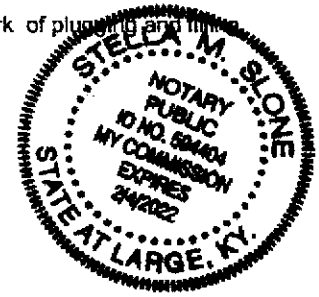

Affidavit reviewed by the Office of Oil and Gas: [Signature] Title: Inspector

Attachment A

Ritter 507791

47-109-02147

Bottom	Actual TOC	Sks of Cement
5236'	4990'	20
4148'	4031'	15
4012'	3842'	30
3332'	3202'	15
1948'	1836'	15
1276'	1159'	32
420'	1102'	40
420'	317'	40
204'	Surface	80



07/09/2021

WELL PLUGGING INSPECTION & RELEASE FORM

PLUGGING COMMENCED 6/3/21
 PLUGGING COMPLETED 6/11/21
 VERBAL PERMISSION ON _____

OPERATOR: CM ENERGY HOLDINGS, LP
 FARM: PLUM CREEK TIMBERLANDS
 WELL NO: RITTER 507791

1. IS COAL BEING MINED IN THE AREA? YES NO N/A
2. WERE CEMENT AND GEL MIXED AND USED IN ACCORDANCE WITH ACCEPTED INDUSTRY STANDARDS?
 - A. BOTTOM HOLE PLUGGED YES NO N/A
 - B. 100' PLUGS YES NO N/A
 - C. LATEX PLUGS USED FOR H₂S GAS YES NO N/A
 - D. PROPER PLUGS THROUGH COAL SEAMS YES NO N/A
 - E. PROPER PLUGS SET TO PROTECT FRESHWATER YES NO N/A
 - F. PROPER AMOUNT OF GEL USED TO DISPLACE PLUGS YES NO N/A

TYPE	FROM	TO	PIPE REMOVED
Class A Cement	5236'	4990'	1224' 4 1/2"
Class A Cement	4148'	4031'	
Class A Cement	4012'	3842'	
Class A Cement	3332'	3202'	
Class A Cement	1948'	1836'	
Class A Cement	1276'	1159'	
Class A Cement	420'	317'	
Class A Cement	207'	Surface	
6% Gel Between Plugs			

3. WERE ALL CHANGES APPROVED BY INSPECTOR? YES NO
4. WAS THE EQUIPMENT USED FOR PULLING CASING PROPERLY SIZED AND RIGGED TO PULL 150% OF THE HEAVIEST STRING OF PIPE EXPECTED TO BE PULLED? YES NO
5. DID THE OPERATOR GIVE THE INSPECTOR PROPER NOTICE? YES NO
6. WERE ACCURATE PLUGGING RECORDS KEPT BY THE OPERATOR? YES NO
7. WAS A PROPER MONUMENT SET WITH API NUMBER ATTACHED? YES NO
8. DID WELL SITE AND ACCESS ROAD MEET THE FOLLOWING RECLAMATION REQUIREMENTS?

A. RECLAIMED <input checked="" type="radio"/> YES NO	B. FENCES REPLACED <input checked="" type="radio"/> YES NO
C. MULCHED <input checked="" type="radio"/> YES NO	D. PROPER DRAINAGE <input checked="" type="radio"/> YES NO
E. SEEDED <input checked="" type="radio"/> YES NO	F. ALL EQUIPMENT REMOVED <input checked="" type="radio"/> YES NO
G. PIT BACKFILLED <input checked="" type="radio"/> YES NO	

7/6/21
DATE RELEASED

Henry Kennedy
INSPECTOR'S SIGNATURE

RECORD ALL VISITS TO THIS WELL ON PAGE 2