

STATE OF WEST VIRGINIA  
DEPARTMENT OF ENVIRONMENTAL PROTECTION  
OFFICE OF OIL AND GAS

AFFIDAVIT OF PLUGGING AND FILLING WELL

AFFIDAVIT SHOULD BE IN TRIPLICATE, one copy mailed to the Department, one copy to be retained by the Well Operator and the third copy (and extra copies if required) should be mailed to each coal operator at their respective addresses.

Farm name: US ARMY CORP. OF ENG. Operator Well No.: 507020

LOCATION: Elevation: 1208' Quadrangle: GILBERT  
District: HUFF CREEK County: WYOMING  
Latitude: 37.5792345087285 Feet South of \_\_\_\_\_ Deg. \_\_\_\_\_ Min. \_\_\_\_\_ Sec.  
Longitude: -81.7608499742721 Feet West of \_\_\_\_\_ Deg. \_\_\_\_\_ Min. \_\_\_\_\_ Sec.

Well Type: OIL \_\_\_\_\_ GAS X

Company DIVERSIFIED PRODUCTION LLC Coal Operator NO DECLARATION  
101 MCQUISTON DRIVE or Owner \_\_\_\_\_  
JACKSON CENTER, PA 16133 \_\_\_\_\_  
Agent JEFF MAST Coal Operator \_\_\_\_\_  
Permit Issued Date 5/24/21 or Owner \_\_\_\_\_

AFFIDAVIT

STATE OF WEST VIRGINIA,  
County of LINCOLN ss:


MELVIN MYERS and JAMES PURSLEY being first duly sworn according to law depose and say that they are experienced in the work of plugging and filling oil and gas wells and were employed by the above named well operator, and participated in the work of plugging and filling the above well say that said work was commenced on the 14TH day of JUNE, 2021, and the well was plugged and filled in the following manner:

TYPE	FROM	TO	PIPE REMOVED	LEFT
C1A CEMENT	5528'	4228'	1097' X 4.5" CSG	4453' X 4.5" CSG CEMENTED
C1A CEMENT	3495'	3300'		
C1A CEMENT	1698'	1492'		1574' X 7" CSG CTS
C1A CEMENT	1219'	1047'		
C1A CEMENT	510'	SURFACE		681' X 9 5/8" CSG CTS
7% OIL SPACERS BETWEEN PLUGS				122' X 13 3/8" CSG CTS

Description of monument: 7" CSG WITH API#, 36" ABOVE GROUND and that the work of plugging and filling said well was completed on the 17TH day of JUNE, 2021.

And further deponents saith not. [Signatures]

Sworn and subscribe before me this 17TH day of June, 2021

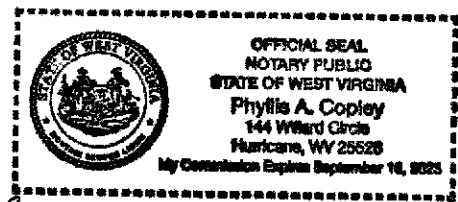

My commission expires: September 16, 2023 Phyllis A. Copley  
Notary Public

Affidavit reviewed by the Office of Oil and Gas: [Signature] Title: Inspector

**WELL PLUGGING INSPECTION & RELEASE FORM**

PLUGGING COMMENCED 6/14/21  
 PLUGGING COMPLETED 6/17/21  
 VERBAL PERMISSION ON \_\_\_\_\_

OPERATOR: Diers, Fred Production  
 FARM: US ARMY Corp. of Eng.  
 WELL NO: 507020

1. IS COAL BEING MINED IN THE AREA? YES NO N/A
2. WERE CEMENT AND GEL MIXED AND USED IN ACCORDANCE WITH ACCEPTED INDUSTRY STANDARDS?
  - A. BOTTOM HOLE PLUGGED  YES NO N/A
  - B. 100' PLUGS  YES NO N/A
  - C. LATEX PLUGS USED FOR H<sub>2</sub>S GAS  YES NO  N/A
  - D. PROPER PLUGS THROUGH COAL SEAMS  YES NO N/A
  - E. PROPER PLUGS SET TO PROTECT FRESHWATER  YES NO N/A
  - F. PROPER AMOUNT OF GEL USED TO DISPLACE PLUGS  YES NO N/A

TYPE	FROM	TO	PIPE REMOVED
Cement Class A	5528'	4228'	1097 4.5 casing
Cement Class A	3495'	3300'	
Cement Class A	1698'	1492'	
Cement Class A	1219'	1047'	
Cement Class A	510'	Surface	
6% Gel between Plugs			

3. WERE ALL CHANGES APPROVED BY INSPECTOR?  YES NO
4. WAS THE EQUIPMENT USED FOR PULLING CASING PROPERLY SIZED AND RIGGED TO PULL 150% OF THE HEAVIEST STRING OF PIPE EXPECTED TO BE PULLED?  YES NO
5. DID THE OPERATOR GIVE THE INSPECTOR PROPER NOTICE?  YES NO
6. WERE ACCURATE PLUGGING RECORDS KEPT BY THE OPERATOR?  YES NO
7. WAS A PROPER MONUMENT SET WITH API NUMBER ATTACHED?  YES NO
8. DID WELL SITE AND ACCESS ROAD MEET THE FOLLOWING RECLAMATION REQUIREMENTS?
 

A. RECLAIMED	<input checked="" type="checkbox"/> YES	NO	B. FENCES REPLACED	<input checked="" type="checkbox"/> YES	NO
C. MULCHED	<input checked="" type="checkbox"/> YES	NO	D. PROPER DRAINAGE	<input checked="" type="checkbox"/> YES	NO
E. SEEDED	<input checked="" type="checkbox"/> YES	NO	F. ALL EQUIPMENT REMOVED	<input checked="" type="checkbox"/> YES	NO
G. PIT BACKFILLED	<input checked="" type="checkbox"/> YES	NO			

10/18/21  
DATE RELEASED

[Signature]  
INSPECTOR'S SIGNATURE

RECORD ALL VISITS TO THIS WELL ON PAGE 2